

Accredited for compliance with ISO/IEC 17025-Testing

WORLD RECOGNISED ACCREDITATION

Accreditation No. 14184.

# Acciona Samsung Bouygues Joint Venture (ASBJV)

# WestConnex M4-M5 Link Project

Ambient Air Quality and Weather Monitoring Validated Report

1st August 2022 – 31st August 2022

Report No.: DAT18783

Report issue date: 15<sup>th</sup> September 2022

Maintenance contract: MC2237

Acoem Australasia (Ecotech Pty Ltd). ABN: 32005752081

1492 Ferntree Gully Rd, Knoxfield VIC. 3180. AUSTRALIA

Tel No: 1300 364 946 Fax No: 1300 668 763

Email: info.au@acoem.com WEB: www.acoem.com.au

This document shall not be reproduced except for in full, without the written approval of Acoem Australasia (Ecotech Pty Ltd).

**Report No: DAT18783** 





Customer Details		
Customer	Acciona Samsung Bouygues Joint Venture (ASBJV)	
Contact name	Mr. Alex Holloway	
Address	Level 7, 189 O'Riordan Street, Mascot, NSW 2020 PO Box 63, Mascot NSW 1460	

Revision History				
Revision Report ID Date Analyst				
0	DAT18783	15/09/2022	Nafise Kazemi	

Report by: Nafise Kazemi elys!

**Approved Signatory:** Jon ALEXANDER

# **Report No: DAT18783**





### **Table of Contents**

Customer Details	2
Revision History	2
Revision	2
Report ID	2
Date	2
Analyst	2
Table of Contents	3
List of Figures	
List of Tables	5
Executive Summary	7
1.0 Introduction	7
2.0 Monitoring and Data Collection	8
2.1. Siting Details	8
Site Name	8
Geographical Coordinates	8
Height Above Sea Level (m)	8
2.2. Monitored Parameters	10
2.3. Data Collection Methods	13
2.3.1. NATA Endorsement and Conformity with Standards	14
2.3.2. Data Acquisition	14
2.4. Data Validation and Reporting	14
2.4.1. Validation	14
2.4.2. Reporting	15

# **Report No: DAT18783**





3.0 Air Quality Goals	17
4.0 Calibrations and Maintenance	18
4.1. Units and Uncertainties	18
4.2. Maintenance	20
4.2.1. Calibration & Maintenance Summary Tables	20
5.0 Results	24
5.1. Data Capture	24
5.2. Air Quality Monthly Summary	26
5.3. Tabulated data	30
5.3.1. Annual average	30
5.4. Graphic Representations	31
6.0 Valid Data Exception Tables	39
7.0 Report Summary	43
Appendix 1 - Definitions & Abbreviations	44
Appendix 2 - Explanation of Exception Table	46
List of Figures	
Figure 1: WCX M4-M5 Link Project Monitoring Station Locations	9
Figure 2: WCX M4-M5 Link Project Air Monitoring Stations - CO 8-Hour Rolling Graph for August 2022	31
Figure 3: WCX M4-M5 Link Project Air Monitoring Stations - NO <sub>2</sub> 1-Hour Averages Graph for August 2022	32
Figure 4: WCX M4-M5 Link Project Air Monitoring Stations - PM <sub>10</sub> 24-Hour Averages Graph for August 2022	33
Figure 5: WCX M4-M5 Link Project Air Monitoring Stations - PM <sub>2.5</sub> 24-Hour Averages Graph for August 2022	34
Figure 6: WCX Albert Street – Wind Rose for August 2022	35
Figure 7: WCX Campbell Street – Wind Rose for August 2022	36

# **Report No: DAT18783**



Figure 8: WCX Ramsay Street – Wind Rose for August 2022	37
Figure 9: WCX Wattle Street – Wind Rose for August 2022	38
List of Tables Table 1: WCX M4-M5 Link Project monitoring sites' locations	8
Table 2: Parameters measured at the WCX - Albert Street and Wattle Street monitoring stations	10
Table 3: Parameters measured at the WCX – Campbell Street monitoring station	11
Table 4: Parameters measured at the WCX – Ramsay Street monitoring station	12
Table 5: Methods	13
Table 6: Automatic Span / Zero/ Stabilisation and Background checks at WestConnex M4-M5 Link stations	16
Table 7: WCX M4-M5 Link Project - Air Quality Goals	17
Table 8: Units and Uncertainties	18
Table 9: WCX Albert Street Maintenance Table August 2022	20
Table 10: WCX Campbell Street Maintenance Table August 2022	21
Table 11: WCX Ramsay Street Maintenance Table August 2022	22
Table 12: WCX Wattle Street Maintenance Table August 2022	23
Table 13: Data Capture for WCX M4-M5 Link Project Ambient Air Quality Network	25
Table 14: WCX Albert Street Exceedances Recorded for August 2022	26
Table 15: WCX Campbell Street Exceedances Recorded for August 2022	27
Table 16: WCX Ramsay Street Exceedances Recorded for August 2022	28
Table 17: WCX Wattle Street Exceedances Recorded for August 2022	29
Table 18: $PM_{10}$ and $PM_{2.5}$ averages at the WCX M4-M5 Link ambient air monitoring stations 2022	30
Table 19: WCX Albert Street Valid Data Exception Table	39
Table 20: WCX Campbell Street Valid Data Exception Table	40

# **Report No: DAT18783**



Table 21: WCX Ramsay Street Valid Data Exception Table	41
Table 22: WCX Wattle Street Valid Data Exception Table	42

**Report No: DAT18783** 





### **Executive Summary**

The WestConnex M4-M5 Link project is being constructed in two stages:

- Stage 1: WCX M4-M5 Link Mainline Tunnels
- Stage 2: Rozelle Interchange.

This Monthly Ambient Air Quality Monitoring Report is specific to Stage 1 of the project, which generally compromises twin mainline motorway tunnels between the M4 at Haberfield and the M8 at St Peters. Each tunnel would be around 7.5 kilometres long and would generally accommodate up to four lanes of traffic in each direction.

WCX M4-M5 Link Mainline tunnels air quality is monitored by hundreds of sensors and measures various pollutants across three mains areas:

- Ambient air air quality in the areas around the WCX M4-M5 Link Mainline tunnels
- Ventilation air quality around the ventilation stacks
- In Tunnel air quality inside the tunnels and portals (entrances to the tunnel)

This Report details ambient air measurements. It is part of the commitment to the Minister and the community to report air quality measurements in real-time (raw data as the measurements occur) as well as validated reports. It is important to re-publish the data in reports because the raw data needs to be checked and collated by approved air quality experts and 'translated' into a format that is easy to understand and can be interpreted by both experts and laypeople.

This report details results at four external ambient air quality monitoring stations located at Albert Street, Campbell St, Ramsay Street and Wattle Street between 1<sup>st</sup> August 2022 and 31<sup>st</sup> August 2022.

#### **Report Summary**

Percentage availability for all parameters at the WestConnex M4-M5 Link Ambient Air Quality Monitoring Network was above 95% during the reporting. Please refer to Table 13, and Tables 19-22 for details.

There were no exceedance of the air quality goals at the WestConnex M4-M5 Link Ambient Air Quality Monitoring Network for the reporting month. Please refer to Tables 14-17 in Section 5.2 – Air Quality Monthly Summary for further information.

### **Report No: DAT18783**





### 1.0 Introduction

Acoem Australasia (Ecotech) was commissioned by Acciona Samsung Bouygues Joint Venture (ASBJV) to provide monitoring and data reporting for the WCX M4-M5 Link Project ambient air quality and weather monitoring network, located as detailed in Table 1. Acoem Australasia (Ecotech) commenced data collection in November 2021.

This report presents the available data for August 2022.

The data presented in this report:

- Describes air quality measurements;
- Compares monitoring results;
- Has been quality assured;
- Complies with NATA accreditation requirements, where applicable.

### 2.0 Monitoring and Data Collection

### 2.1. Siting Details

The WCX M4-M5 Link Project monitoring network consists of four ambient air quality and weather monitoring stations. The stations' location and siting details are described below.

Table 1: WCX M4-M5 Link Project monitoring sites' locations

Site Name	Geographical Coordinates	Height Above Sea Level (m)
Albert Street	33°54'52.07"S, 151°10'45.07"E	12
Campbell Street	33°54'44.71"S, 151°10'43.76"E	15
Ramsay Street	33°52'26.20"S, 151°8'1.50"E	4
Wattle Street	33°52'32.88"S, 151° 8'2.67"E	16

### **Report No: DAT18783**

Acciona Samsung Bouygues Joint Venture (ASBJV)



A siting audit to assess sites for compliance with AS/NZS 3580.1.1:2016 and AS/NZS 3580.14:2014 have been completed as follows:

- Albert Street on 28/10/2021
- Campbell Street on 07/07/2022
- Ramsay Street on 17/11/2021
- Wattle Street on 02/11/2021



Figure 1: WCX M4-M5 Link Project Monitoring Station Locations

### **Report No: DAT18783**

**Acciona Samsung Bouygues Joint Venture (ASBJV)** 



#### 2.2. Monitored Parameters

Tables 2-4 below detail the parameters monitored and the instruments used at the WCX M4-M5 Link Project monitoring stations. Appendix 1 defines any abbreviated parameter names used throughout the report.

Table 2: Parameters measured at the WCX - Albert Street and Wattle Street monitoring stations

Station(s)	Parameter Measured	Instrument and Measurement Technique	Elevation
	СО	Acoem Australasia (Ecotech) Serinus 30 –  NDIR gas filter correlation infrared  photometry	2 m
	NO, NO <sub>2</sub> , NO <sub>x</sub>	Acoem Australasia (Ecotech) Serinus 40 – gas phase chemiluminescence	2 m
	PM <sub>2.5</sub>	Met One BAM 1020 – Beta ray attenuation	2 m
	PM <sub>10</sub>	Thermo – 1405 TEOM (Tapered Element Oscillating Microbalance)	2m
Albert Street Wattle Street	Differential Temperature (Elevation 2m)	Acoem Australasia (Ecotech) E031220	2 m
	Differential Temperature (Elevation 10m)	Acoem Australasia (Ecotech) E031220	10 m
	Wind Speed (Horizontal, elevation 10m)	Gill Windsonic Op3	10 m
	Wind Direction (elevation 10m)	Gill Windsonic Op3	10 m
	Sigma	Calculation	-

**Report No: DAT18783** 



Table 3: Parameters measured at the WCX – Campbell Street monitoring station

Station(s)	Parameter Measured	Instrument and Measurement Technique	Elevation
	СО	Acoem Australasia (Ecotech) Serinus 30 –  NDIR gas filter correlation infrared  photometry	2 m
	NO, NO <sub>2</sub> , NO <sub>x</sub>	Acoem Australasia (Ecotech) Serinus 40 – gas phase chemiluminescence	2 m
	PM <sub>2.5</sub>	Met One BAM 1020 – Beta ray attenuation	2 m
	PM <sub>10</sub>	Thermo – 1400 ab TEOM (Tapered Element Oscillating Microbalance)	2m
Campbell Street	Differential Temperature (Elevation 2m)	Acoem Australasia (Ecotech) E031220	2 m
	Differential Temperature (Elevation 10m)	Acoem Australasia (Ecotech) E031220	10 m
	Wind Speed (Horizontal, elevation 10m)	Gill Windsonic Op3	10 m
	Wind Direction (elevation 10m)	Gill Windsonic Op3	10 m
	Sigma	Calculation	-

**Report No: DAT18783** 



Table 4: Parameters measured at the WCX – Ramsay Street monitoring station

Station(s)	Parameter Measured	Instrument and Measurement Technique	Elevation
	СО	Acoem Australasia (Ecotech) Serinus 30 –  NDIR gas filter correlation infrared  photometry	2 m
	NO, NO <sub>2</sub> , NO <sub>x</sub>	Acoem Australasia (Ecotech) Serinus 40 – gas phase chemiluminescence	2 m
	PM <sub>2.5</sub>	Met One BAM 1020 – Beta ray attenuation	2 m
	PM <sub>10</sub>	Thermo – 1400 ab TEOM (Tapered Element Oscillating Microbalance)	2m
Ramsay Street	Differential Temperature (Elevation 2m)	Met One 062MP	2 m
	Differential Temperature (Elevation 10m)	Met One 062MP	10 m
	Wind Speed (Horizontal, elevation 10m)	Gill Windsonic Op3	10 m
	Wind Direction (elevation 10m)	Gill Windsonic Op3	10 m
	Sigma	Calculation	-

# **Report No: DAT18783**

**Acciona Samsung Bouygues Joint Venture (ASBJV)** 



#### 2.3. Data Collection Methods

Table 5 below shows the methods used for data collection.

**Table 5: Methods** 

Parameter Measured	Data Collection Methods Used	Description of Method
NO, NO <sub>2</sub> , NO <sub>x</sub>	AS 3580.5.1 - 2011	Methods for sampling and analysis of ambient air - Method 5.1: Determination of oxides of nitrogen-Chemiluminescence method
СО	AS 3580.7.1 - 2011	Methods for sampling and analysis of ambient air. Method 7.1:  Determination of carbon monoxide—Direct-reading  instrumental method
PM <sub>10</sub> (TEOM)	AS 3580.9.8-2008	Methods for sampling and analysis of ambient air. Method 9.8: Determination of suspended particulate matter - $PM_{10}$ continuous direct mass method using a tapered element oscillating microbalance analyser.
PM <sub>2.5</sub> (BAM 1020)	AS/NZS 3580.9.12-2013 <sup>1</sup>	Methods for sampling and analysis of ambient Air - Method 9.12: Determination of suspended particulate matter—PM <sub>2.5</sub> beta attenuation monitors
Vector Wind Speed (Horizontal)	AS 2923-1987 <sup>2</sup>	Methods for sampling and analysis of ambient air. Method 14:  Meteorological monitoring for ambient air quality monitoring applications
Vector Wind Direction	AS 2923-1987 <sup>2</sup>	Methods for sampling and analysis of ambient air. Method 14:  Meteorological monitoring for ambient air quality monitoring applications
Sigma	AS 2923-1987 <sup>2</sup>	Methods of sampling and analysis of ambient air. Method 14:  Meteorological monitoring for ambient air quality monitoring applications
Atmospheric Temperature	USEPA (2000) EPA 454/R- 99-005 <sup>2</sup>	Methods for sampling and analysis of ambient air. Method 14:  Meteorological monitoring for ambient air quality monitoring applications

<sup>&</sup>lt;sup>1</sup> As approved by the Department of Planning and Environment on 30<sup>th</sup> August 2021.

<sup>&</sup>lt;sup>2</sup> Superseded by AS/NZ 3580.14 2014 but specifically referenced in ministerial conditions.

**Report No: DAT18783** 

Acciona Samsung Bouygues Joint Venture (ASBJV)



Note: Two different measurement techniques are used for monitoring  $PM_{10}$  and  $PM_{2.5}$  at the WCX M4-M5 Link Project Stations. Studies conducted in Canada, the United States and other countries have found that the Tapered Element Oscillating Microbalance (TEOM) monitors can under report concentrations compared to the Beta Attenuation Monitors (BAM), especially when the air contains a large proportion of semi-volatile particulate matter, which may be the case during cooler seasons when the air contains less coarse dust and a greater proportion of semi-volatile organic compounds such as those associated with wood smoke. As a result, it is normal to see occasional periods where  $PM_{10} < PM_{2.5}$  and this situation does not necessarily indicate a fault with either instrument.

#### 2.3.1. NATA Endorsement and Conformity with Standards

Unless stated below, parameters are monitored at the WCX M4-M5 Link Project Stations according to the stated methods detailed in Table 5 above.

#### 2.3.2. Data Acquisition

Data acquisition is performed using a PC based WinAQMS logger (using WinAQMS® Version 2.0) and Congrego logger situated at each of the monitoring sites. Each logger is equipped with a 3G modem for remote data collection. The recorded data is remotely collected from the Air Quality Monitoring Station (AQMS) loggers on a daily basis (using Airodis<sup>TM</sup> version 5.2) and stored at Acoem Australasia (Ecotech)'s Environmental Reporting Services (ERS) department in Melbourne, Australia. Data samples are logged in 5-minute intervals.

#### 2.4. Data Validation and Reporting

#### 2.4.1. Validation

The Acoem Australasia (Ecotech) ERS department performs daily data checks to ensure maximum data capture rates are maintained. Any equipment failures are communicated to the responsible field engineers for urgent rectification. Acoem Australasia (Ecotech) ERS maintains two distinct databases containing non-validated and validated data respectively.

The validated database is created by duplicating the non-validated database and then flagging data affected by instrument faults, calibrations and other maintenance activities. The data validation software requires the analyst to supply a valid reason (e.g., backed by maintenance notes, calibration sheets etc.) in the database for flagging any data as invalid.

Details of all invalid or missing data are recorded in the Valid Data Exception Tables.

Validation is performed by the analyst, and the validation is reviewed. Graphs and tables are generated based on the validated five minutes and one-hour data as appropriate.

**Report No: DAT18783** 

Acciona Samsung Bouygues Joint Venture (ASBJV)



#### 2.4.2. Reporting

Data is reported in four Microsoft Excel format files named:

- WCX M4-M5 Link Albert St Monthly Data Report August 2022.xls
- WCX M4-M5 Link Campbell St Monthly Data Report August 2022.xls
- WCX M4-M5 Link Ramsay St Monthly Data Report August 2022.xls
- WCX M4-M5 Link Wattle St Monthly Data Report August 2022.xls

Each Excel file consists of 6 worksheets:

- 1. Cover
- 2. Contents
- 3. 5 Minute Data
- 4. 1 Hour Data
- 5. 24-hour Data
- 6. Valid Data Exception Report

The data contained in this report is based on Australian Eastern Standard Time.

All averages are calculated from the five-minute and the one-hour data. Averages are based on a minimum of 75% valid readings within the averaging period. Where data capture is low for a particular parameter, summary values (e.g., monthly maximum and minimum) may be based on less than 75% valid samples. The reader should use caution when interpreting these values as they may not be representative of conditions for the entire sample period.

Averaging periods of eight hours or less are reported for the end of the period, i.e., the hourly average 02:00am is for the data collected from 1:00am to 2:00am. One-hour averages are calculated based on a clock hour. One day averages are calculated based on calendar days.

# **Report No: DAT18783**

Acciona Samsung Bouygues Joint Venture (ASBJV)



# Table 6: Automatic Span / Zero/ Stabilisation and Background checks at WestConnex M4-M5 Link stations

Station	Parameter	Span / Zero / Stabilisation	Background
Albert St.	NO / NO <sub>2</sub> / NO <sub>x</sub>	01:00 - 01:25	n/a
Albert St.	СО	01:00 - 01:25	23:55 – 00:00
0	NO / NO <sub>2</sub> / NO <sub>x</sub>	01:00 - 01:45	n/a
Campbell St.	СО	01:00 - 01:45	23:45 – 23:50
Ramsay St.	NO / NO <sub>2</sub> / NO <sub>x</sub>	00:45 - 01:05	n/a
Kallisay St.	СО	00:45 - 01:05	23:45 – 23:50
Wattle St.	NO / NO <sub>2</sub> / NO <sub>x</sub>	01:00 - 01:25	n/a
	СО	01:00 - 01:25	23:45 – 23:50

**Report No: DAT18783** 

Acciona Samsung Bouygues Joint Venture (ASBJV)



### 3.0 Air Quality Goals

The air quality goals and criteria for pollutants monitored at the WCX M4-M5 Link Project ambient monitoring sites are based on SSI 7485 Planning Approval Condition E6. The air quality goals and criteria are shown in Table 7 below.

Table 7: WCX M4-M5 Link Project - Air Quality Goals

Parameter	Time Period	Goal Level	Units
СО	8 hours (rolling, based on 1-hour averages)	9.0	ppm
NO <sub>2</sub>	1 hour	0.12	ppm
DM	1 day	50	μg/m³
PM <sub>10</sub>	1 year	25	μg/m³
DNA	1 day	25	μg/m³
PM <sub>2.5</sub>	1 year	8	μg/m³

#### Note:

This table includes all valid data points that exceed the defined air quality standards. The Ambient Air Quality NEPM includes a provision for excluding 1-day  $PM_{10}$  or  $PM_{2.5}$  averages associated with "exceptional events" from the total exceedances of the Air Quality standard. The definition of an "exceptional event" is included below for reference. It is the responsibility of the end user of this data to evaluate whether any reported exceedances are associated with exceptional events and are eligible to be excluded from the exceedance total. Monitoring and reporting of exceedances during the operational project will be in accordance with the Planning Approval Conditions E10, E11 and E12.

As per the Ambient Air Quality NEPM, *Exceptional event* means a fire or dust occurrence that adversely affects air quality at a particular location, and causes an exceedance of 1-day average standards in excess of normal historical fluctuations and background levels, and is directly related to: bushfire; jurisdiction authorised hazard reduction burning; or continental scale windblown dust.

**Report No: DAT18783** 

**Acciona Samsung Bouygues Joint Venture (ASBJV)** 



### 4.0 Calibrations and Maintenance

#### 4.1. Units and Uncertainties

The uncertainties for each parameter have been determined by the manufacturer's tolerance limits of the equipment's parameters, and by the data collection standard method.

The reported uncertainties are expanded uncertainties, calculated using coverage factors which give a level of confidence of approximately 95%.

**Table 8: Units and Uncertainties** 

Parameter	Units	Resolution	Uncertainty	Measurement Range <sup>3</sup>
NO, NO <sub>x</sub> (S40)	ppm	0.001 ppm	± (6% of reading + 0.011 ppm) k factor of 2.0	0 to 0.5 ppm LDL = 0.0004 ppm
NO <sub>2</sub> (S40)	ppm	0.001 ppm	± (6% of reading + 0.011 ppm) k factor of 2.0	0 to 0.5 ppm LDL = 0.0004 ppm
CO (S30)	ppm	0.1 ppm	± (7% of reading + 0.8 ppm) k factor of 2.0	0 to 50 ppm LDL = 0.04 ppm
PM <sub>2.5</sub> (BAM1020)	μg/m³	1 μg/m³	24Hr: $\pm$ (5.5% of reading + 4.0 μg/m³) (in range 0 - 100 μg/m³) Hr: $\pm$ (8% of reading + 8.0 μg/m³) k factor of 2.0	0 to 1000 μg/m³  LDL <sub>24hr</sub> = 1.0 μg/m³  LDL <sub>hr</sub> = 4.8 μg/m³
PM <sub>10</sub> (TEOM)	μg/m³	0.1 μg/m³	± 5.0 μg/m³ or 3.6% of reading, whichever is the greater K factor of 2.0	0 to 1 g/m³ LDL = 5 μg/m³
Vector Wind Speed	m/s	0.1 m/s	± 0.4 m/s or 2 % of reading, whichever is greater K factor of 2.0	0 to 30 m/s
Vector Wind Direction	Deg	1 deg	± 4 deg K factor of 2.0	0 to 360 deg Starting threshold: 0 m/s

<sup>&</sup>lt;sup>3</sup> Uncertainties may not be calculated based on the full measurement range. The max measurement range for gas analysers is defined as the full scale (FS=Span/0.8).

**Report No: DAT18783** 





Parameter	Units	Resolution	Uncertainty	Measurement Range <sup>3</sup>
Ambient Temperature	°K	0.1°K	± 0.6°K K factor of 2.0	263.15°C to 323.15°C

### **Report No: DAT18783**

Acciona Samsung Bouygues Joint Venture (ASBJV)



#### 4.2. Maintenance

#### 4.2.1. Calibration & Maintenance Summary Tables

The last calibrations for the following parameters were performed on the indicated dates. Data supplied after this time is subject to further validation, to be performed at the next calibration cycle.

Note: Maintenance and calibration dates may differ, as calibrations may be less frequent than scheduled maintenance visits.

Tables 9-12 indicate when the particulate and gas and meteorological equipment were last maintained/calibrated.

**Table 9: WCX Albert Street Maintenance Table August 2022** 

Parameter	Date of Last Scheduled Maintenance	Maintenance Type⁴	Date of Last Calibration	Calibration Cycle
NO, NO <sub>2</sub> , NO <sub>x</sub>	11/08/22	3 Monthly	11/08/22	Monthly
СО	11/08/22	Monthly	11/08/22	Monthly
PM <sub>10</sub>	11/08/22	3 Monthly	27/10/21	Yearly
PM <sub>2.5</sub>	11/08/22	Monthly	27/10/21	Yearly
WS/WD/Sigma	11/08/22	3 Monthly	16/06/21 <sup>5</sup>	2 Yearly
Differential Temperature 2m	11/08/22	3 Monthly	12/05/22	6 Monthly
Differential Temperature 10m	11/08/22	3 Monthly	12/05/22	6 Monthly

<sup>&</sup>lt;sup>4</sup> Additional visits may have been made as required.

<sup>&</sup>lt;sup>5</sup> Wind sensor calibrated on 16/06/21 and installed at this site on 27/10/21.

**Report No: DAT18783** 



Table 10: WCX Campbell Street Maintenance Table August 2022

Parameter	Date of Last Scheduled Maintenance	Maintenance Type <sup>6</sup>	Date of Last Calibration	Calibration Cycle
NO, NO <sub>2</sub> , NO <sub>x</sub>	09/08/22	Monthly	09/08/22	Monthly
СО	09/08/22	Monthly	09/08/22	Monthly
PM <sub>10</sub>	09/08/22	Monthly	10/01/22	Yearly
PM <sub>2.5</sub>	09/08/22	Monthly	07/07/22	Yearly
WS/WD/Sigma	09/08/22	Monthly	23/03/217	2 Yearly
Differential Temperature 2m	09/08/22	Monthly	07/07/22	6 Monthly
Differential Temperature 10m	09/08/22	Monthly	07/07/22	6 Monthly

<sup>&</sup>lt;sup>6</sup> Additional visits may have been made as required.

 $<sup>^{7}</sup>$  Wind sensor calibrated on 23/03/21 and installed at this site on 10/06/21.

**Report No: DAT18783** 



Table 11: WCX Ramsay Street Maintenance Table August 2022

Parameter	Date of Last Scheduled Maintenance	Maintenance Type <sup>8</sup>	Date of Last Calibration	Calibration Cycle
NO, NO <sub>2</sub> , NO <sub>x</sub>	10/08/22	3 Monthly	10/08/22	Monthly
СО	10/08/22	Monthly	10/08/22	Monthly
PM <sub>10</sub>	10/08/22	3 Monthly	16/11/21	Yearly
PM <sub>2.5</sub>	10/08/22	Monthly	16/11/21	Yearly
WS/WD/Sigma	10/08/22	3 Monthly	24/02/22 <sup>9</sup>	2 Yearly
Differential Temperature 2m	10/08/22	3 Monthly	10/05/22	6 Monthly
Differential Temperature 10m	10/08/22	3 Monthly	10/05/22	6 Monthly

<sup>&</sup>lt;sup>8</sup> Additional visits may have been made as required.

 $<sup>^{9}</sup>$  Wind sensor calibrated on 24/02/22 and installed at this site on 10/05/22.

**Report No: DAT18783** 



**Table 12: WCX Wattle Street Maintenance Table August 2022** 

Parameter	Date of Last Scheduled Maintenance	Maintenance Type <sup>10</sup>	Date of Last Calibration	Calibration Cycle
NO, NO <sub>2</sub> , NO <sub>x</sub>	10/08/22	3 Monthly	10/08/22	Monthly
СО	10/08/22	Monthly	10/08/22	Monthly
PM <sub>10</sub>	10/08/22	3 Monthly	01/11/21	Yearly
PM <sub>2.5</sub>	22/08/22	2 Monthly	01/11/21	Yearly
WS/WD/Sigma	10/08/22	3 Monthly	15/06/21 <sup>11</sup>	2 Yearly
Differential Temperature 2m	10/08/22	3 Monthly	16/05/22	6 Monthly
Differential Temperature 10m	10/08/22	3 Monthly	16/05/22	6 Monthly

 $<sup>^{10}</sup>$  Additional visits may have been made as required.

 $<sup>^{11}</sup>$  Wind sensor calibrated on 15/06/21 and installed at this site on 01/11/21.

**Report No: DAT18783** 





#### 5.0 Results

#### 5.1. Data Capture

Valid data capture refers to the amount of valid data collected during the report period. It is based on 5-minute data, for gaseous and meteorological parameters and 1-hour data for particulate parameters.

The percentage of valid data captured is calculated using the following equation:

Valid Data capture = (Reported air quality data / Total data) x 100%

#### Where:

- Reported air quality data = Number of samples (instrument readings) which have been validated through a quality assured process and excludes all data errors, zero data collection due to calibration, equipment failures, planned and unplanned maintenance.
- Total data = Total number of samples (instrument readings) expected for the sampling period.
  Total data is calculated based on the same averaging period as "reported air quality data" and
  the duration of the corresponding report period. e.g., for 5-minute data collected over a
  month of 31 days, the total data would be equal to 12 (5-minute samples in an hour) x 24
  (hours in a day) x 31 (days in a month) = 8928 samples.

Table 13 below displays data capture statistics for August 2022. **Bold** values in the table indicate data capture below 95%.

Details of all invalid or missing data affecting data capture are included in the Valid Data Exception Tables, see section 6.0.

**Report No: DAT18783** 



Table 13: Data Capture for WCX M4-M5 Link Project Ambient Air Quality Network

	Data Capture (%)				
Parameter	Albert Street	Campbell Street	Ramsay Street	Wattle Street	
PM <sub>2.5</sub>	99.9	99.5	99.6	99.1	
PM <sub>10</sub>	99.6	99.5	99.3	99.2	
СО	96.7	95.7	97.2	96.5	
NO, NO <sub>2</sub> , NO <sub>x</sub>	97.5	96.0	97.9	97.2	
WS, WD, Sigma	100.0	99.5	99.6	99.3	
AT 2m	100.0	99.5	99.6	98.8	
AT 10m	100.0	99.5	99.6	98.8	

**Report No: DAT18783** 

**Acciona Samsung Bouygues Joint Venture (ASBJV)** 



### 5.2. Air Quality Monthly Summary

Tables 14-17 below include a summary of any exceedances recorded at the WCX M4-M5 Link Project stations during the reported period<sup>12</sup>.

Table 14: WCX Albert Street Exceedances Recorded for August 2022

Parameter	Time Period	Value of Exceedance	Date of Exceedance
NO <sub>2</sub> (ppm)	1 hour	-	-
CO (ppm)	8-hour rolling	-	-
DN4 (ug/m³)	24-hour	-	-
PM <sub>10</sub> (μg/m³)	Annual <sup>13</sup>	-	-
DN4 (ug/m3)	24-hour	-	-
PM <sub>2.5</sub> (μg/m <sup>3</sup> )	Annual <sup>14</sup>	-	-

<sup>&</sup>lt;sup>12</sup> Exceedances are based on the decimal places reported.

<sup>&</sup>lt;sup>13</sup> Insufficient data to report annual average in 2022, any exceedances will be included in December 2022 report.

<sup>&</sup>lt;sup>14</sup> Insufficient data to report annual average in 2022, any exceedances will be included in December 2022 report.

**Report No: DAT18783** 



Table 15: WCX Campbell Street Exceedances Recorded for August 2022

Parameter	Time Period	Value of Exceedance	Date of Exceedance
NO <sub>2</sub> (ppm)	1 hour	-	-
CO (ppm)	8-hour rolling	-	-
PM <sub>10</sub> (μg/m³)	24-hour	-	-
	Annual <sup>15</sup>	-	-
DA4 (/3)	24-hour	-	-
PM <sub>2.5</sub> (μg/m <sup>3</sup> )	Annual <sup>16</sup>	-	-

<sup>&</sup>lt;sup>15</sup> Insufficient data to report annual average in 2022, any exceedances will be included in December 2022 report.

<sup>&</sup>lt;sup>16</sup> Insufficient data to report annual average in 2022, any exceedances will be included in December 2022 report.

**Report No: DAT18783** 



Table 16: WCX Ramsay Street Exceedances Recorded for August 2022

Parameter	Time Period	Value of Exceedance	Date of Exceedance
NO <sub>2</sub> (ppm)	1 hour	-	-
CO (ppm)	8-hour rolling	-	-
DNA (117/123)	24-hour	-	-
PM <sub>10</sub> (μg/m³)	Annual <sup>17</sup>	-	-
DA4 ((3)	24-hour	-	-
PM <sub>2.5</sub> (μg/m <sup>3</sup> )	Annual <sup>18</sup>	-	-

<sup>&</sup>lt;sup>17</sup> Insufficient data to report annual average in 2022, any exceedances will be included in December 2022 report.

<sup>&</sup>lt;sup>18</sup> Insufficient data to report annual average in 2022, any exceedances will be included in December 2022 report.

**Report No: DAT18783** 



Table 17: WCX Wattle Street Exceedances Recorded for August 2022

Parameter	Time Period	Value of Exceedance	Date of Exceedance
NO <sub>2</sub> (ppm)	1 hour	-	-
CO (ppm)	8-hour rolling	-	-
DN4 (112/223)	24-hour	-	-
PM <sub>10</sub> (μg/m³)	Annual <sup>19</sup>	-	-
DA4 (= (=3)	24-hour	-	-
PM <sub>2.5</sub> (μg/m <sup>3</sup> )	Annual <sup>20</sup>	-	-

<sup>&</sup>lt;sup>19</sup> Insufficient data to report annual average in 2022, any exceedances will be included in December 2022 report.

<sup>&</sup>lt;sup>20</sup> Insufficient data to report annual average in 2022, any exceedances will be included in December 2022 report.

### **Report No: DAT18783**

Acciona Samsung Bouygues Joint Venture (ASBJV)



#### 5.3. Tabulated data

### 5.3.1. Annual average

Table 18 displays monthly averages of the  $PM_{2.5}$  and  $PM_{10}$  parameters collected at WCX M4-M5 Link ambient air monitoring stations for 2022. Averages shown are for the 2021 calendar year, up to the current reported month. Table requires at least 75% valid data to display a monthly average. Footer values are based on all available data for 2022 rather than the average of individual months. This gives an indication of performance against the annual objectives.

Table 18: PM<sub>10</sub> and PM<sub>2.5</sub> averages at the WCX M4-M5 Link ambient air monitoring stations 2022

Month	Albert Street		Campbell Street		Ramsay Street		Wattle Street	
	PM <sub>10</sub> (μg/m³)	PM <sub>2.5</sub> (μg/m³)						
Jan-22	19.5	4.8	15.9	5.5	13.5	3.9	18.9	4.9
Feb-22	20.3	6.2	16.9	6.8	16.0	5.0	20.1	6.7
Mar-22	16.2	3.8	13.5	5.0	-	-	15.8	5.1
Apr-22	14.6	5.5	12.0	5.9	-	-	15.3	5.7
May-22	16.2	6.8	13.1	6.8	-	6.1	16.4	6.3
Jun-22	14.9	6.7	12.6	7.1	13.5	7.1	17.8	6.6
Jul-22	14.1	6.2	12.5	6.4	11.1	7.4	16.5	6.5
Aug-22	13.5	5.1	11.7	4.9	10.9	6.6	15.7	5.0
Sep-22	-	-	1	-	-	-	-	-
Oct-22	-	-	1	-	-	-	-	-
Nov-22	-	-	-	-	-	-	-	-
Dec-22	-	-	-	-	-	-	-	-
Average	16.2	5.6	13.5	6.0	13.0	6.0	17.1	5.8

### **Report No: DAT18783**

**Acciona Samsung Bouygues Joint Venture (ASBJV)** 



### 5.4. Graphic Representations

This section displays graphs of the pollutants and meteorological parameters monitored at the WCX M4-M5 Link Project for August 2022. The graphs are based on validated 5 minutes or 1-hour data as appropriate.

# CO 8-Hour (Rolling, based on 1-Hour Averages)

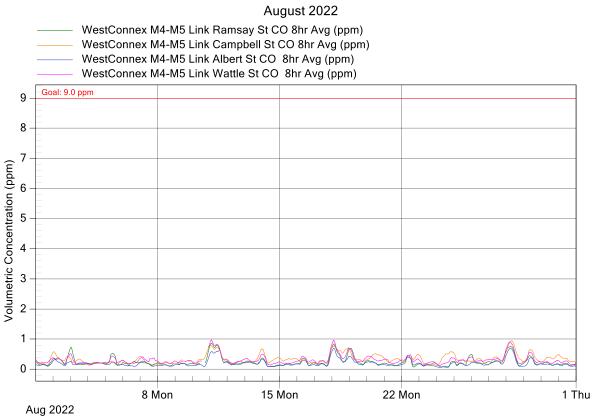


Figure 2: WCX M4-M5 Link Project Air Monitoring Stations - CO 8-Hour Rolling Graph for August 2022

### **Report No: DAT18783**

**Acciona Samsung Bouygues Joint Venture (ASBJV)** 



## NO<sub>2</sub> 1-Hour Averages

August 2022

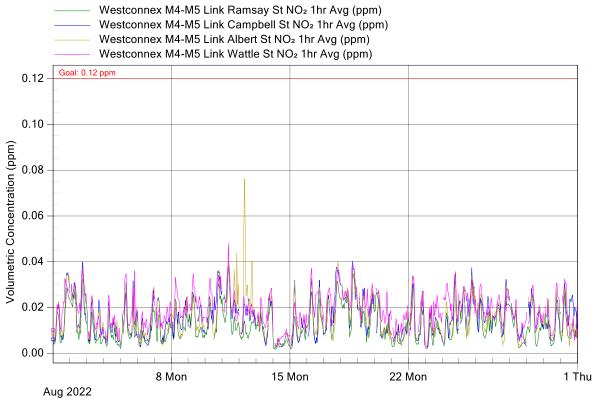


Figure 3: WCX M4-M5 Link Project Air Monitoring Stations - NO<sub>2</sub> 1-Hour Averages Graph for August 2022

### **Report No: DAT18783**

**Acciona Samsung Bouygues Joint Venture (ASBJV)** 



# PM<sub>10</sub> 24-Hour Averages

August 2022

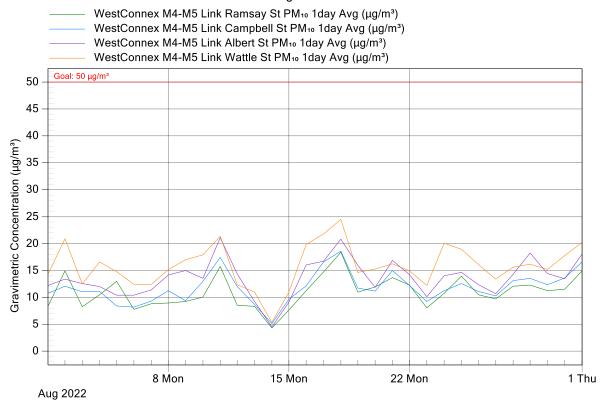


Figure 4: WCX M4-M5 Link Project Air Monitoring Stations - PM<sub>10</sub> 24-Hour Averages Graph for August 2022

### **Report No: DAT18783**

**Acciona Samsung Bouygues Joint Venture (ASBJV)** 



### PM<sub>2.5</sub> 24-Hour Averages



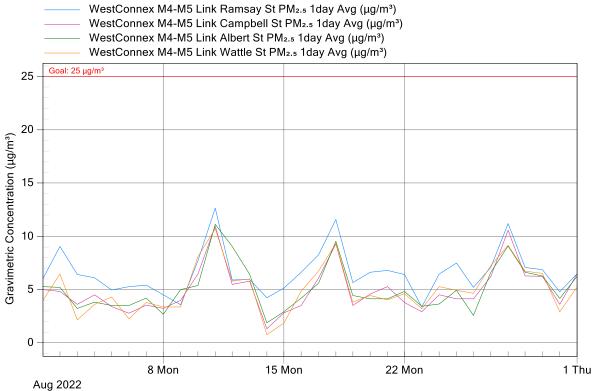


Figure 5: WCX M4-M5 Link Project Air Monitoring Stations - PM<sub>2.5</sub> 24-Hour Averages Graph for August 2022

# **Report No: DAT18783**

0.0% calm

100.0% valid data present



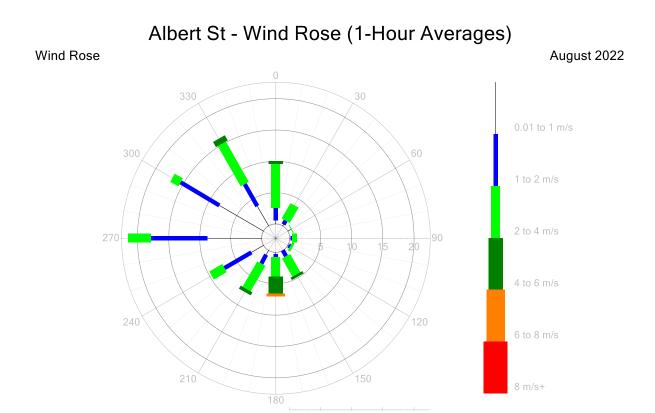



Figure 6: WCX Albert Street – Wind Rose for August 2022

### **Report No: DAT18783**

**Acciona Samsung Bouygues Joint Venture (ASBJV)** 





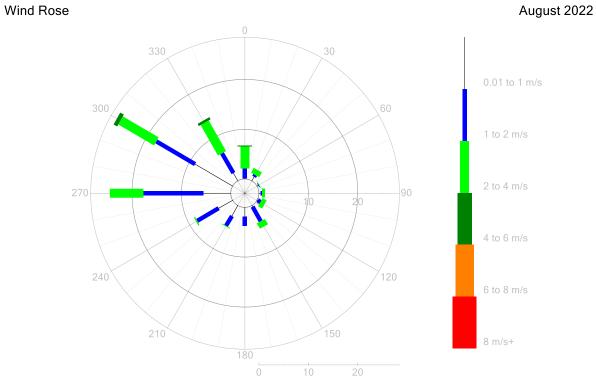

0.0% calm 99.5% valid data present

Figure 7: WCX Campbell Street – Wind Rose for August 2022

### **Report No: DAT18783**

99.6% valid data present




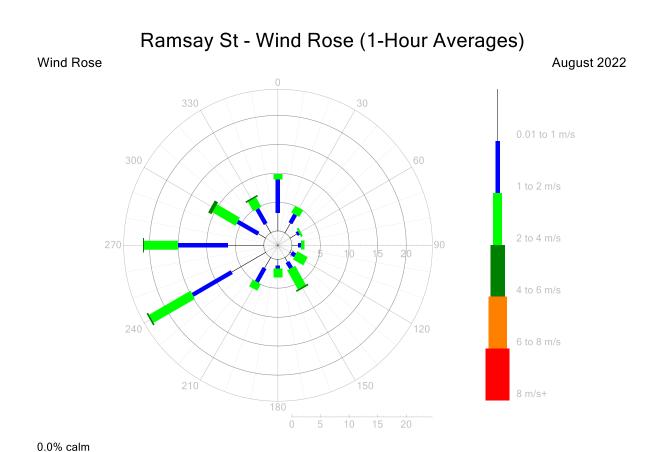



Figure 8: WCX Ramsay Street – Wind Rose for August 2022

### **Report No: DAT18783**

**Acciona Samsung Bouygues Joint Venture (ASBJV)** 





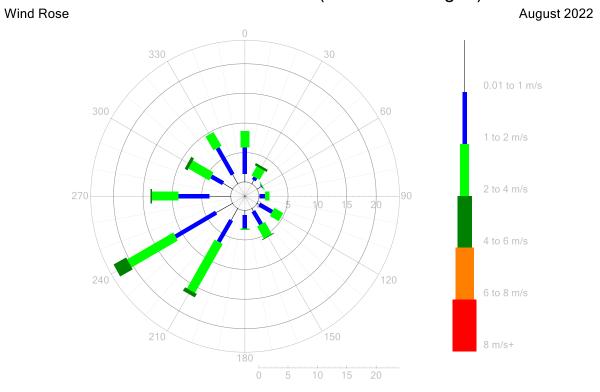

0.0% calm 99.2% valid data present

Figure 9: WCX Wattle Street – Wind Rose for August 2022

**Report No: DAT18783** 

**Acciona Samsung Bouygues Joint Venture (ASBJV)** 



# **6.0 Valid Data Exception Tables**

Tables 19–22 below detail all changes made to the raw data set during the validation process. An explanation of reasons given in the table can be found in Appendix 2.

**Table 19: WCX Albert Street Valid Data Exception Table** 

Start Date	End Date	Reason	Change Details	User Nam e	Change Date
01/08/22 00:00	01/09/22 00:00	Background checks, once daily for 5 to 10 minutes	СО	NK	15/09/22
01/08/22 01:00	01/09/22 01:25	Automatic span and zero checks, once daily from 01:00 to 01:25	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	NK	15/09/22
03/08/22 00:25	24/08/22 16:00	Intermittent instrument fault - CO status error	СО	NK	15/09/22
11/08/22 12:00	11/08/22 15:05	Scheduled 3 monthly maintenance - Instrument calibrations followed by instrument stabilisation	AT 2m, AT 10m, WS, WD, Sigma, CO, NO, NO <sub>2</sub> , NO <sub>x</sub> , PM <sub>10</sub>	NK	15/09/22
17/08/22 09:05	17/08/22 09:05	Data transmission error	All parameters	NK	15/09/22
23/08/22 17:00	23/08/22 17:00	Instrument fault - Flow error	PM <sub>2.5</sub>	NK	15/09/22

**Report No: DAT18783** 



**Table 20: WCX Campbell Street Valid Data Exception Table** 

Start Date	End Date	Reason	Change Details	User Name	Change Date
01/08/22 00:00	31/08/22 14:10	Intermittent static offsets applied as required to correct unstable baseline.  Values range from -0.30 ppm to +1.00 ppm	СО	NK	15/09/22
01/08/22 01:00	31/08/22 01:45	Automatic span and zero checks, once daily from 01:00 to 01:45	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	NK	15/09/22
01/08/22 23:45	31/08/22 23:45	Background checks, once daily for 5 to 10 minutes	СО	NK	15/09/22
03/08/22 01:50	25/08/22 23:40	Intermittent linear offsets applied as required to correct unstable baseline.  A values 0.00 ppm and B values range from -0.60 ppm to +0.40 ppm	СО	NK	15/09/22
04/08/22 10:05	30/08/22 17:50	Intermittent unrealistic negative readings	PM <sub>10</sub>	NK	15/09/22
05/08/22 14:00	05/08/22 14:00	Unrealistic negative reading	NO, NO <sub>2</sub> , NO <sub>x</sub>	NK	15/09/22
09/08/22 09:00	09/08/22 12:45	Scheduled 2 monthly maintenance - Instrument calibrations followed by instrument stabilisation	All parameters	NK	15/09/22

**Report No: DAT18783** 



**Table 21: WCX Ramsay Street Valid Data Exception Table** 

Start Date	End Date	Reason	Change Details	User Name	Change Date
01/08/22 00:45	31/08/22 01:10	Automatic span and zero checks, once daily from 00:45 to 01:05 followed by instrument stabilisation	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	NK	15/09/22
01/08/22 12:40	30/08/22 17:45	Intermittent unrealistic negative readings	PM <sub>10</sub>	NK	15/09/22
01/08/22 23:45	31/08/22 23:45	Background checks, once daily for 5 minutes	СО	NK	15/09/22
03/08/22 05:20	24/08/22 09:25	Intermittent unrealistic negative readings	NO, NO <sub>2</sub> , NO <sub>x</sub>	NK	15/09/22
05/08/22 18:55	18/08/22 00:20	Intermittent data transmission error	AT 2m, AT 10m, WS, WD, Sigma, CO, NO, NO <sub>2</sub> , NO <sub>x</sub> , PM <sub>10</sub>	NK	15/09/22
10/08/22 09:00	10/08/22 12:40	Scheduled 3 monthly maintenance - Instrument calibrations followed by instrument stabilisation	All parameters	NK	15/09/22

**Report No: DAT18783** 



**Table 22: WCX Wattle Street Valid Data Exception Table** 

Start Date	End Date	Reason	Change Details	User Name	Change Date
01/08/22 01:00	31/08/22 01:25	Automatic span and zero checks, once daily from 01:00 to 01:25	CO, NO, NO <sub>2</sub> , NO <sub>x</sub>	NK	15/09/22
01/08/22 23:00	31/08/22 23:00	Data affected by met power supply reset every night for 5 to 10 minutes	AT 2m, AT 10m	NK	15/09/22
01/08/22 23:45	31/08/22 23:50	Background checks, once daily for 5 to 10 minutes followed by intermittent instrument stabilisation	СО	NK	15/09/22
10/08/22 12:50	10/08/22 16:15	Scheduled 3 monthly maintenance - Instrument calibrations followed by instrument stabilisation	All parameters	NK	15/09/22
14/08/22 02:15	30/08/22 18:00	Intermittent unrealistic negative readings	NO, NO <sub>2</sub> , NO <sub>x</sub> , PM <sub>10</sub>	NK	15/09/22
14/08/22 10:35	21/08/22 11:30	Intermittent instrument fault - Flow error	PM <sub>10</sub>	NK	15/09/22
22/08/22 11:00	22/08/22 13:00	Non scheduled maintenance - BAM flow controller replaced, flow audit and leak check performed	All parameters	NK	15/09/22

**Report No: DAT18783** 

**Acciona Samsung Bouygues Joint Venture (ASBJV)** 



### 7.0 Report Summary

 Percentage availability for all parameters at the WestConnex M4-M5 Link Ambient Air Quality Monitoring Network was above 95% during the reporting.

Please refer to Table 13, and Tables 19-22 for details.

• There were no exceedance of the air quality goals at the WestConnex M4-M5 Link Ambient Air Quality Monitoring Network for the reporting month.

Please refer to Tables 14-17 in Section 5.2 – Air Quality Monthly Summary for further information.

**Report No: DAT18783** 





# **Appendix 1 - Definitions & Abbreviations**

ERS Environmental Reporting Services

AQMS Air Quality Monitoring Station

AQM Air Quality Monitor

BAM Beta Attenuation Monitors

TEOM Tapered Element Oscillating Microbalance

° Degrees (True North)

K Kelvin

LDL Lower Detectable Limit

Micrograms per cubic metre at standard temperature and pressure (0°C and 101.3  $\mu g/m^3$ 

kPa)

AT Ambient Temperature

Wind conditions where the wind speed is below the operating range of the wind calm

sensor

CO Carbon monoxide

mg/m<sup>3</sup> Milligrams per cubic metre at standard temperature and pressure (0°C and 101.3

kPa)

mm Millimeter

NO Nitric oxide

NO<sub>2</sub> Nitrogen dioxide

NO<sub>x</sub> Oxides of nitrogen

PM<sub>10</sub> Particulate less than 10 microns in equivalent aerodynamic diameter

PM<sub>2.5</sub> Particulate less than 2.5 microns in equivalent aerodynamic diameter

# **Report No: DAT18783**





ppb Parts per billion

ppm Parts per million

RH Relative Humidity

WD Vector Wind Direction

WS Vector Wind Speed

**Report No: DAT18783** 

Acciona Samsung Bouygues Joint Venture (ASBJV)



# **Appendix 2 - Explanation of Exception Table**

**Automatic filter tape advance** refers to the movement of the filter paper by the analyser to an unused spot.

**Automatic background check** refers to when analyser samples zero air and measures the level of the concentration voltage. This voltage is taken as the zero signal level and this value is subtracted from any subsequent readings as an active zero compensation. This is the analyser's fine zero measurement.

**Automatic span/zero check.** The E-Sampler is programmed to perform a zero calibration check whereby air is passed through filter element, removing particulates, before entering the sensor in the analyser. Data is invalidated when these checks occur.

**Beta count failure** refers to a fault in the functioning of the EBAM. A one minute beta count was less than the maximum acceptable counts during operation.

**Calibration check outside tolerance** refers to when the calibration values are outside the tolerance limits set for the precision check.

Calibration correction factor applied to data refers to an offset or multiplier applied to the data. This operation may be performed for a number of reasons including: (a) when a clear trend / drift outside the tolerance limit can be demonstrated by repeated operation precision checks, (b) when a correction is required on previously logged data due to a calibration check being outside the allowable tolerance

**Commissioning** refers to the initial setup and calibration of the instrument when it is first installed. For some instruments there may be a stabilisation period before normal operation commences.

**Data transmission error** refers to a period of time when the instrument could not transmit data. This may be due to interference, or a problem with the phone line or modem.

**Equipment malfunction/instrument fault** refers to a period of time when the instrument was not in the normal operating mode and did not measure a representative value of the existing conditions.

**Gap in data/data not available** refers to a period of time when either data has been lost or could not be collected.

**Instrument Alarm** refers to an alarm produced by the instrument. A range of alarms can be produced depending on how operation of the instrument is being affected.

### **Report No: DAT18783**

**Acciona Samsung Bouygues Joint Venture (ASBJV)** 



**Instrument out of service** refers to a lack of data due to an instrument being shut down for repair, maintenance, or factory calibration.

**Linear offset or multiplier** refers to when an offset or multiplier has been applied between two points where the values of the offset or multiplier are different and the correction is interpolated between the two points.

**Logger error** refers to when an error occurs and instrument readings are not correctly recorded by the logger.

**Maintenance** refers to a period of time when the logger/instrument was switched off due to maintenance.

**Overnight span/zero out of tolerance** refers to when the span/zero reading measured by the analyser during an automatic precision check falls outside of the expected concentration limits.

**Overnight zero out of tolerance** refers to when the automatic zero reading measured by the analyser falls outside the expected limits.

Power Interruption refers to no power to the station therefore no data was collected at this time.

**Remote Calibration** refers to when a technician remotely connects to the station and manually performs a span check.

**Static offset or multiplier** refers to when a single offset or multiplier has been applied to the data between two points either to increase or decrease the measured value.

**Tape break** refers to the breaking of the EBAM/BAM sample tape during operation.

**Warm up after power interruption** refers to the startup period of an instrument after power has been restored.