

WestConnex

M4 East Project

Ambient Air Quality and Weather Monitoring Validated Report

1st February 2019 – 28th February 2019

Report No.: DAT14343

Report issue date: 15th March 2019

Maintenance contract: MC2148

ECOTECH PTY LTD. ABN: 32005752081

1492 Ferntree Gully Rd, Knoxfield VIC. 3180. AUSTRALIA

Tel No: 1300 364 946 Fax No: 1300 668 763

Email ecotech@ecotech.com WEB www.ecotech.com

This document shall not be reproduced except for in full, without the written approval of Ecotech Pty Ltd.

Customer Details	
Customer	CPB Samsung John Holland Joint Venture
Contact name	Will Benson
Address	L2, 52 Railway Parade, Burwood, NSW 2134

Revision History			
Revision	Report ID	Date	Analyst
0	DAT14343	15/03/2019	Adriana Alvarez

Report by:

Adriana Alvarez



Approved Signatory:

Jon Alexander



Table of Contents

Customer Details..... 2

Revision History 2

Table of Contents..... 3

List of Figures 4

List of Tables 5

Executive Summary..... 7

1.0 Introduction 8

2.0 Monitoring and Data Collection..... 8

 2.1. Siting Details..... 8

 2.2. Monitored Parameters 10

 2.3. Data Collection Methods 11

 2.3.1. Data Acquisition 13

 2.4. Data Validation and Reporting..... 13

 2.4.1. Validation 13

 2.4.2. Reporting..... 13

3.0 Air Quality Goals 15

4.0 Calibrations and Maintenance 16

 4.1. Units and Uncertainties 16

 4.2. Maintenance 17

 4.2.1. Calibration & Maintenance Summary Tables 17

5.0 Results..... 24

 5.1. Data Capture 24

5.2.	Air Quality Monthly Summary	26
5.3.	Tabulated data	32
5.3.1.	Annual average	32
5.4.	Graphic Representations	33
6.0	Valid Data Exception Tables.....	43
7.0	Report Summary	52
Appendix 1 - Definitions & Abbreviations.....		53
Appendix 2 - Explanation of Exception Table		55

List of Figures

Figure 1:	M4 East Project Monitoring Station Locations	9
Figure 2:	M4 East Project Air Monitoring Stations - CO 8 hours Rolling graph for February 2019	33
Figure 3:	M4 East Project Air Monitoring Stations - NO ₂ graph for February 2019.....	34
Figure 4:	M4 East Project Air Monitoring Stations - PM ₁₀ 24 Hour graph for February 2019	35
Figure 5:	M4 East Project Air Monitoring Stations - PM _{2.5} 24 Hour graph February 2019	36
Figure 6:	Allen Street – Wind Rose for February 2019	37
Figure 7:	Concord Oval – Wind Rose for February 2019.....	38
Figure 8:	Haberfield Public School – Wind Rose for February 2019	39
Figure 9:	Powells Creek – Wind Rose for February 2019.....	40
Figure 10:	Ramsay Street – Wind Rose for February 2019	41
Figure 11:	Saint Lukes Park – Wind Rose for February 2019	42

List of Tables

Table 1: WestConnex M4 NSW East Project monitoring sites locations	8
Table 2: Parameters measured at the M4 East Project monitoring stations	10
Table 3: Methods	11
Table 4: M4 East Project - Air Quality Goals	15
Table 5: Units and Uncertainties.....	16
Table 6: M4 East Project Allen Street Maintenance Table February 2019	18
Table 7: M4 East Project Concord Oval Maintenance Table February 2019	19
Table 8: M4 East Project Haberfield Public School Maintenance Table February 2019.....	20
Table 9: M4 East Project Powells Creek Maintenance Table February 2019	21
Table 10: M4 East Project Ramsay Street Maintenance Table February 2019.....	22
Table 11: M4 East Project Saint Lukes Park Maintenance Table February 2019.....	23
Table 12: Data Capture for M4 East Project Ambient Air Quality Network	25
Table 13: M4 East Project Allen Street Exceedences Recorded for February 2019	26
Table 14: M4 East Project Concord Oval Exceedences Recorded for February 2019.....	27
Table 15: M4 East Project Haberfield Public School Exceedences Recorded for February 2019	28
Table 16: M4 East Project Powells Creek Exceedences Recorded for February 2019.....	29
Table 17: M4 East Project Ramsay Street Exceedences Recorded for February 2019	30
Table 18: M4 East Project Saint Lukes Park Exceedences Recorded for February 2019	31
Table 19: PM ₁₀ and PM _{2.5} averages at the WestConnex M4 ambient air monitoring stations 2019.....	32
Table 20: Allen Street Valid Data Exception Table.....	43
Table 21: Concord Oval Valid Data Exception Table	45
Table 22: Haberfield Public School Valid Data Exception Table	46



Table 23: Powells Creek Valid Data Exception Table	48
Table 24: Ramsay Street Valid Data Exception Table	50
Table 25: Saint Lukes Park Valid Data Exception Table	51

Executive Summary

The M4 East project is a component of the WestConnex scheme, a NSW Government initiative to connect Sydney's west and south-west with the Sydney Airport and the Port Botany precinct. The project includes the widening of the existing M4 between Homebush Bay Drive and Underwood Road. Two new three-lane tunnels of approximately 5.5 km will extend from west of Pomeroy Street, Homebush to Alt Street at Haberfield. Interchanges or ramps will be upgraded or installed to allow access to/from the tunnel at the following locations: Homebush Bay Drive, Concord Road, Wattle Street and Parramatta Road at Ashfield/Haberfield. Tunnel ventilation facilities will be installed within the existing M4 road reserve near Underwood Road, Homebush and at the corner of Parramatta Road and Wattle Street at Haberfield. Operational ancillary facilities will be installed at Cintra Park. Associated road works, particularly at Parramatta Road to the M4 at Powells Creek and modification of the intersection of the existing M4 and Parramatta Road will also be undertaken as part of the works.

Ecotech Pty Ltd has been commissioned by CPB Samsung John Holland Joint Venture for air quality monitoring, data collection and reporting at six external ambient air quality monitoring stations: Allen Street AQM (Air Quality Monitoring), Powells Creek AQM, St Lukes Park AQM, Concord Oval AQM, Ramsay Street AQM and Haberfield Public School AQM.

1.0 Introduction

Ecotech Pty Ltd was commissioned by CPB Samsung John Holland Joint Venture to provide monitoring and data reporting for the M4 East Project ambient air quality and weather monitoring network, located as detailed in Table 1. Ecotech commenced data collection in December 2017.

This report presents the available data for February 2019.

The data presented in this report:

- Describes air quality measurements;
- Compares monitoring results;
- Has been quality assured;
- Complies with NATA accreditation requirements, where applicable.

2.0 Monitoring and Data Collection

2.1. Siting Details

The WestConnex M4 East Project monitoring network consists of six ambient air quality and weather monitoring stations. The stations location and siting details are described below.

Table 1: WestConnex M4 NSW East Project monitoring sites locations

Site Name	Geographical Coordinates	Height Above Sea Level (m)
Allen Street	33°51'44.21"S, 151° 5'9.79"E	3
Concord Oval	33°52'8.60"S, 151° 6'28.97"E	7
Haberfield Public School	33°52'45.70"S, 151° 8'4.01"E	26
Powells Creek	33°51'53.80"S, 151° 5'16.50"E	10
Ramsay Street	33°52'26.20"S, 151° 8'1.50"E	5
Saint Lukes Park	33°51'55.04"S, 151° 6'35.88"E	4

A siting audit to assess sites for compliance with *AS/NZS 3580.1.1:2016* has been completed as follows:

- Allen Street on 14/11/2018 (Meteorological Siting Audit completed on 26/02/2019)
- Concord Oval on 14/11/2018 (Meteorological Siting Audit completed on 26/02/2019)
- Haberfield Public School on 02/10/2018
- Powells Creek on 14/11/2018
- Ramsay Street on 05/02/2019
- Saint Lukes Park on 09/11/2018

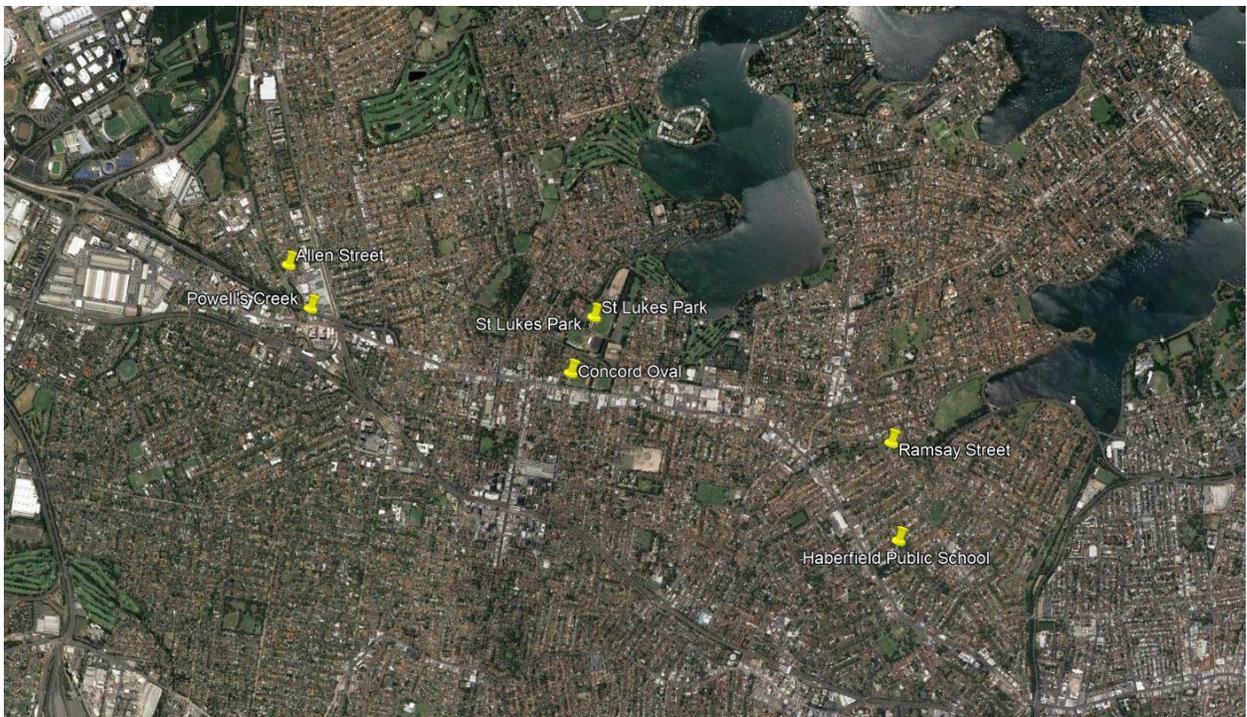


Figure 1: M4 East Project Monitoring Station Locations

2.2. Monitored Parameters

Table 2 below details the parameters monitored and the instruments used at the M4 East Project monitoring stations. Appendix 1 defines any abbreviated parameter names used throughout the report.

Table 2: Parameters measured at the M4 East Project monitoring stations

Station(s)	Parameter Measured	Instrument and Measurement Technique	Elevation
Allen Street Concord Oval Haberfield Public School Powells Creek Ramsay Street Saint Lukes Park	CO	Ecotech Serinus 30 – NDIR gas filter correlation infrared photometry	2 m
	NO, NO ₂ , NO _x	Ecotech Serinus 40 – gas phase chemiluminescence	2 m
	PM _{2.5}	Met One BAM 1020 – Beta ray attenuation	2 m
	PM ₁₀	Thermo – 1400 ab TEOM (Tapered Element Oscillating Microbalance)	2m
	Differential Temperature (elevation 2m)	Met One 062MP	2 m
	Differential Temperature (elevation 10m)	Met One 062MP	10 m
	Wind Speed (Horizontal, elevation 10m)	Gill Windsonic Op3	10 m
	Wind Direction (elevation 10m)	Gill Windsonic Op3	10 m
	Sigma	Calculation	-

2.3. Data Collection Methods

Table 3 below shows the methods used for data collection.

Table 3: Methods

Parameter Measured	Data Collection Methods Used	Description of Method
NO, NO ₂ , NO _x	AS 3580.5.1 - 2011	Methods for sampling and analysis of ambient air - Method 5.1: Determination of oxides of nitrogen-Chemiluminescence method
	Ecotech Laboratory Manual	In-house method 6.1 - Oxides of nitrogen by chemiluminescence
CO	AS 3580.7.1 - 2011	Methods for sampling and analysis of ambient air. Method 7.1: Determination of carbon monoxide—Direct-reading instrumental method
	Ecotech Laboratory Manual	In-house method 6.3 – Carbon monoxide by gas filter correlation spectrophotometry
PM ₁₀ (TEOM)	AS/NZ 3580.9.8-2008	Methods for sampling and analysis of ambient air. Method 9.8: Determination of suspended particulate matter - PM ₁₀ continuous direct mass method using a tapered element oscillating microbalance analyser.
	Ecotech Laboratory Manual	In-house method 7.3- Particulates - PM _{2.5} , PM ₁₀ by TEOM
PM _{2.5} (BAM 1020)	AS/NZS 3580.9.12-2013 ¹	Methods for sampling and analysis of ambient Air - Method 9.12: Determination of suspended particulate matter—PM _{2.5} beta attenuation monitors
	Ecotech Laboratory Manual	In-house method 7.5 – Measurement of PM ₁₀ , PM _{2.5} and TSP using Beta Attenuation Monitor
Vector Wind Speed (Horizontal)	AS 2923-1987 ²	Methods for sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications

¹ As approved by the Department of Planning and Environment on 8th September 2017.

² Superseded by AS/NZ 3580.14 2014 but specifically referenced in ministerial conditions.

Parameter Measured	Data Collection Methods Used	Description of Method
	Ecotech Laboratory Manual	In-house method 8.1 - Wind speed (Horizontal) by anemometer
Vector Wind Direction	AS 2923-1987 ³	Methods for sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications
	Ecotech Laboratory Manual	In-house method 8.3 - Wind direction by anemometer
Sigma	AS 2923-1987 ³	Methods of sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications
	Ecotech Laboratory Manual	In-house method 8.3 Wind direction by anemometer
Atmospheric Temperature	USEPA (2000) EPA 454/R-99-005 ³	Methods for sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications
	Ecotech Laboratory Manual	In-house method 8.4 – Temperature ambient by thermoelectric techniques

Note: Two different measurement techniques are used for monitoring PM₁₀ and PM_{2.5} at the M4 East Project Stations. Studies conducted in Canada, the United States and other countries have found that the Tapered Element Oscillating Microbalance (TEOM) monitors can under report concentrations compared to the Beta Attenuation Monitors (BAM), especially when the air contains a large proportion of semi-volatile particulate matter, which may be the case during cooler seasons when the air contains less coarse dust and a greater proportion of semi-volatile organic compounds such as those associated with wood smoke. As a result, it is normal to see occasional periods where PM₁₀ < PM_{2.5} and this situation does not necessarily indicate a fault with either instrument.

³ Superseded by AS/NZ 3580.14 2014 but specifically referenced in ministerial conditions.

2.3.1. Data Acquisition

Data acquisition is performed using a PC based WinAQMS logger (using WinAQMS® Version 2.0) situated at each of the monitoring sites. Each logger is equipped with a 3G modem for remote data collection. The recorded data is remotely collected from the Air Quality Monitoring Station (AQMS) loggers on a daily basis (using Airodis™ version 5.1.0) and stored at Ecotech's Environmental Reporting Services (ERS) department in Melbourne, Australia. Data samples are logged in 5-minute intervals.

2.4. Data Validation and Reporting

2.4.1. Validation

The Ecotech ERS department performs daily data checks to ensure maximum data capture rates are maintained. Any equipment failures are communicated to the responsible field engineers for urgent rectification. Ecotech ERS maintains two distinct databases containing non-validated and validated data respectively.

The validated database is created by duplicating the non-validated database and then flagging data affected by instrument faults, calibrations and other maintenance activities. The data validation software requires the analyst to supply a valid reason (e.g. backed by maintenance notes, calibration sheets etc.) in the database for flagging any data as invalid.

Details of all invalid or missing data are recorded in the Valid Data Exception Tables.

Validation is performed by the analyst, and the validation is reviewed. Graphs and tables are generated based on the validated five minutes and one-hour data as appropriate.

2.4.2. Reporting

Data is reported in six Microsoft Excel format files named

- *WestConnex_M4_Allen St_ Monthly Data Report_ February 2019.xls*
- *WestConnex_M4_Concord Oval_ Monthly Data Report_ February 2019.xls*
- *WestConnex_M4_Haberfield School_ Monthly Data Report_ February 2019.xls*
- *WestConnex_M4_Powells Creek_ Monthly Data Report_ February 2019.xls*
- *WestConnex_M4_Ramsay St_ Monthly Data Report_ February 2019.xls*
- *WestConnex_M4_St Lukes Park_ Monthly Data Report_ February 2019.xls*

Each Excel file consists of 5 worksheets:

1. Cover
2. 5 Minute Data
3. 1 Hour Data
4. 24-hour Data
5. Valid Data Exception Report

The data contained in this report is based on Australian Eastern Standard Time.

All averages are calculated from the five-minute and the one-hour data. Averages are based on a minimum of 75% valid readings within the averaging period. Where data capture is low for a particular parameter, summary values (e.g. monthly maximum and minimum) may be based on less than 75% valid samples. The reader should use caution when interpreting these values as they may not be representative of conditions for the entire sample period.

Averaging periods of eight hours or less are reported for the end of the period, i.e. the hourly average 02:00am is for the data collected from 1:00am to 2:00am. One-hour averages are calculated based on a clock hour. One day averages are calculated based on calendar days.

3.0 Air Quality Goals

The air quality goals and criteria for pollutants monitored at the M4 East project ambient monitoring sites are based on SSI 6307 Planning Approval Condition E9. The air quality goals and criteria are shown in Table 4 below.

Table 4: M4 East Project - Air Quality Goals

Parameter	Time Period	Goal Level	Units
CO	8 hours (rolling, based on 1-hour averages)	9.0	ppm
NO ₂	1 hour	0.12	ppm
PM ₁₀	1 day	50	µg/m ³
	1 year	25	µg/m ³
PM _{2.5}	1 day	25	µg/m ³
	1 year	8	µg/m ³

Note:

Exceptional events are excluded from this standard. As per the Ambient Air Quality NEPM, **Exceptional event** means a fire or dust occurrence that adversely affects air quality at a particular location and causes an exceedance of 1-day average standards in excess of normal historical fluctuations and background levels and is directly related to: bushfire; jurisdiction authorized hazard reduction burning; or continental scale windblown dust.

Ecotech will include any valid data identified as being associated with an exceptional event in all report tables and graphic representations. For this reason, and as the project monitoring results are part of the baseline monitoring regime, 1-day averages associated with exceptional events will not be counted as exceedances of the Air Quality goals. Monitoring and reporting of exceedances during the operational project will be in accordance with the Planning Approval Conditions E10, E11 and E12.

4.0 Calibrations and Maintenance

4.1 Units and Uncertainties

The uncertainties for each parameter have been determined by the manufacturer's tolerance limits of the equipment's parameters, and by the data collection standard method.

The reported uncertainties are expanded uncertainties, calculated using coverage factors which give a level of confidence of approximately 95%.

Table 5: Units and Uncertainties

Parameter	Units	Resolution	Uncertainty	Measurement Range ⁴
NO, NO _x (S40)	ppm	0.001 ppm	±1.3 ppm or 10% of reading, whichever is the greater k factor of 2.0	0 to 50 ppm
NO ₂ (S40)	ppm	0.001 ppm	± 1.7 ppm k factor of 2.0	0 to 50 ppm
CO (S30)	ppm	0.1 ppm	± 1 ppm or 10% of reading, whichever is the greater k factor of 2.0	0 to 50 ppm
PM _{2.5} (BAM1020)	µg/m ³	1 µg/m ³	±5.0 µg/m ³ + 5.4% of reading K factor of 2.0	5 to 1000 µg/m ³
PM ₁₀ (TEOM)	µg/m ³	0.1 µg/m ³	±5.0 µg/m ³ or 3.6% of reading, whichever is the greater K factor of 2.0	0 µg/m ³ to 1 g/m ³
Vector Wind Speed	m/s	0.1 m/s	±0.4 m/s or 2 % of reading, whichever is greater K factor of 2.0	0 to 30 m/s
Vector Wind Direction	deg	1 deg	±4 deg K factor of 2.0	0 to 360 deg Starting threshold: 0 m/s

⁴ Uncertainties may not be calculated based on the full measurement range.

Parameter	Units	Resolution	Uncertainty	Measurement Range ⁴
Atmospheric Temperature	K	0.1 K	±0.6 K K factor of 2.0	273.15 to 323.15 K

4.2. Maintenance

4.2.1. Calibration & Maintenance Summary Tables

The last calibrations for the following parameters were performed on the indicated dates. Data supplied after this time is subject to further validation, to be performed at the next calibration cycle.

Note: Maintenance and calibration dates may differ, as calibrations may be less frequent than scheduled maintenance visits.

Tables 6-11 indicate when the particulate and gas and meteorological equipment were last maintained/calibrated.

Table 6: M4 East Project Allen Street Maintenance Table February 2019

Parameter	Date of Last Maintenance	Maintenance Type ⁵	Date of Last Calibration	Calibration Cycle
NO, NO ₂ , NO _x	07/02/2019	3 Monthly	07/02/2019	Monthly
CO	07/02/2019	Monthly	07/02/2019	Monthly
PM ₁₀	07/02/2019	3 Monthly	13/11/2018	6 Monthly
PM _{2.5}	07/02/2019	3 Monthly	13/11/2018	Yearly
WS/WD/Sigma	07/02/2019	3 Monthly	06/10/2017	2 yearly
Differential Temperature 2m	07/02/2019	3 Monthly	13/11/2018	6 Monthly
Differential Temperature 10m	07/02/2019	3 Monthly	13/11/2018	6 Monthly

⁵ Additional visits may have been made as required

Table 7: M4 East Project Concord Oval Maintenance Table February 2019

Parameter	Date of Last Maintenance	Maintenance Type ⁶	Date of Last Calibration	Calibration Cycle
NO, NO ₂ , NO _x	06/02/2019	3 Monthly	21/02/2019	Monthly
CO	06/02/2019	Monthly	06/02/2019	Monthly
PM ₁₀	06/02/2019	3 Monthly	14/11/2018	6 Monthly
PM _{2.5}	06/02/2019	3 Monthly	14/11/2018	Yearly
WS/WD/Sigma	06/02/2019	3 Monthly	06/10/2017	2 yearly
Differential Temperature 2m	06/02/2019	3 Monthly	19/11/2018	6 Monthly
Differential Temperature 10m	06/02/2018	3 Monthly	19/11/2018	6 Monthly

⁶ Additional visits may have been made as required.

Table 8: M4 East Project Haberfield Public School Maintenance Table February 2019

Parameter	Date of Last Maintenance	Maintenance Type ⁷	Date of Last Calibration	Calibration Cycle
NO, NO ₂ , NO _x	06/02/2019	3 Monthly	06/02/2019	Monthly
CO	06/02/2019	Monthly	10/02/2019	Monthly
PM ₁₀	06/02/2019	3 Monthly	09/11/2018	6 Monthly
PM _{2.5}	06/02/2019	3 Monthly	25/02/2019 ⁸	Yearly
WS/WD/Sigma	06/02/2019	3 Monthly	05/10/2017	2 yearly
Differential Temperature 2m	06/02/2019	3 Monthly	19/11/2018	6 Monthly
Differential Temperature 10m	06/02/2019	3 Monthly	19/11/2018	6 Monthly

⁷ Additional visits may have been made as required.

⁸ Instrument swapped out

Table 9: M4 East Project Powells Creek Maintenance Table February 2019

Parameter	Date of Last Maintenance	Maintenance Type ⁹	Date of Last Calibration	Calibration Cycle
NO, NO ₂ , NO _x	06/02/2019	3 Monthly	25/02/2019	Monthly
CO	06/02/2019	Monthly	22/02/2019	Monthly
PM ₁₀	06/02/2019	3 Monthly	15/11/2018	6 Monthly
PM _{2.5}	06/02/2019	3 Monthly	15/11/2018	Yearly
WS/WD/Sigma	06/02/2019	3 Monthly	06/10/2017	2 yearly
Differential Temperature 2m	06/02/2019	3 Monthly	20/11/2018	6 Monthly
Differential Temperature 10m	06/02/2019	3 Monthly	20/11/2018	6 Monthly

⁹ Additional visits may have been made as required.

Table 10: M4 East Project Ramsay Street Maintenance Table February 2019

Parameter	Date of Last Maintenance	Maintenance Type ¹⁰	Date of Last Calibration	Calibration Cycle
NO, NO ₂ , NO _x	07/02/2019	3 Monthly	05/02/2019	Monthly
CO	05/02/2019	Monthly	05/02/2019	Monthly
PM ₁₀	06/02/2019	3 Monthly	13/11/2018	6 Monthly
PM _{2.5}	06/02/2019	3 Monthly	12/11/2018	Yearly
WS/WD/Sigma	06/02/2019	3 Monthly	05/10/2017	2 yearly
Differential Temperature 2m	06/02/2019	3 Monthly	19/11/2018	6 Monthly
Differential Temperature 10m	06/02/2019	3 Monthly	19/11/2018	6 Monthly

¹⁰ Additional visits may have been made as required.

Table 11: M4 East Project Saint Lukes Park Maintenance Table February 2019

Parameter	Date of Last Maintenance	Maintenance Type ¹¹	Date of Last Calibration	Calibration Cycle
NO, NO ₂ , NO _x	07/02/2019	3 Monthly	07/02/2019	Monthly
CO	07/02/2019	Monthly	07/02/2019	Monthly
PM ₁₀	07/02/2019	3 Monthly	09/08/2018	6 Monthly
PM _{2.5}	06/02/2019	3 Monthly	12/11/2018	Yearly
WS/WD/Sigma	07/02/2019	3 Monthly	09/10/2017	2 yearly
Differential Temperature 2m	07/02/2019	3 Monthly	20/11/2018	6 Monthly
Differential Temperature 10m	07/02/2019	3 Monthly	20/11/2018	6 Monthly

¹¹ Additional visits may have been made as required.

5.0 Results

5.1. Data Capture

Valid data capture refers to the amount of valid data collected during the report period. It is based on 5-minute data, for gaseous and meteorological parameters and 1-hour data for particulate parameters.

The percentage of valid data captured is calculated using the following equation:

$$\text{Valid Data capture} = (\text{Reported air quality data} / \text{Total data}) \times 100\%$$

Where:

- Reported air quality data = Number of samples (instrument readings) which have been validated through a quality assured process and excludes all data errors, zero data collection due to calibration, equipment failures, planned and unplanned maintenance.
- Total data = Total number of samples (instrument readings) expected for the sampling period. Total data is calculated based on the same averaging period as “reported air quality data” and the duration of the corresponding report period. e.g. for 5-minute data collected over a month of 31 days, the total data would be equal to 12 (5-minute samples in an hour) x 24 (hours in a day) x 31 (days in a month) = 8928 samples.

Table 12 below displays data capture statistics for February 2019. **Bold** values in the table indicate data capture below 95%.

Details of all invalid or missing data affecting data capture are included in the Valid Data Exception Tables, see section 6.0.

Table 12: Data Capture for M4 East Project Ambient Air Quality Network

Parameter	Data Capture (%)					
	Allen Street	Concord Oval	Haberfield School	Powells Creek	Ramsay Street	Saint Lukes Park
PM _{2.5}	98.8	98.4	97.2	95.2	96.4	97.3
PM ₁₀	98.8	98.6	98.5	96.0	99.2	99.5
CO	95.7	95.8	94.7	45.8	93.6	95.4
NO, NO ₂ , NO _x	96.7	95.6	94.9	78.7	94.6	95.3
WS, WD, Sigma	96.7	95.6	94.9	78.7	94.6	95.3
AT 2m	96.7	95.6	94.9	78.7	94.6	95.3
AT 10m	99.2	93.7	98.5	96.5	99.6	99.9

5.2. Air Quality Monthly Summary

Tables 13-18 below include a summary of any exceedances recorded at the M4 East Project stations during the reported period¹².

Table 13: M4 East Project Allen Street Exceedances Recorded for February 2019

Parameter	Time Period	Value of Exceedence	Date of Exceedence
NO ₂ (ppm)	1 hour	-	-
CO (ppm)	8-hour rolling	-	-
PM ₁₀ (µg/m ³)	24-hour	-	-
	Annual	-	-
PM _{2.5} (µg/m ³)	24-hour	-	-
	Annual ¹³	-	-

¹² Exceedances are based on the decimal places reported.

¹³ Insufficient data to report annual average, any exceedances will be reported in December 2019.

Table 14: M4 East Project Concord Oval Exceedences Recorded for February 2019

Parameter	Time Period	Value of Exceedence	Date of Exceedence
NO ₂ (ppm)	1 hour	-	-
CO (ppm)	8-hour rolling	-	-
PM ₁₀ (µg/m ³)	24-hour	-	-
	Annual	-	-
PM _{2.5} (µg/m ³)	24-hour	-	-
	Annual ¹⁴	-	-

¹⁴ Insufficient data to report annual average, any exceedences will be reported in December 2019.

Table 15: M4 East Project Haberfield Public School Exceedences Recorded for February 2019

Parameter	Time Period	Value of Exceedence	Date of Exceedence
NO ₂ (ppm)	1 hour	-	-
CO (ppm)	8-hour rolling	-	-
PM ₁₀ (µg/m ³)	24-hour	-	-
	Annual	-	-
PM _{2.5} (µg/m ³)	24-hour	-	-
	Annual ¹⁵	-	-

¹⁵ Insufficient data to report annual average, any exceedences will be reported in December 2019.

Table 16: M4 East Project Powells Creek Exceedences Recorded for February 2019

Parameter	Time Period	Value of Exceedence	Date of Exceedence
NO ₂ (ppm)	1 hour	-	-
CO (ppm)	8-hour rolling	-	-
PM ₁₀ (µg/m ³)	24-hour	52.4	12/02/2019
	Annual	-	-
PM _{2.5} (µg/m ³)	24-hour	-	-
	Annual ¹⁶	-	-

¹⁶ Insufficient data to report annual average, any exceedences will be reported in December 2019.

Table 17: M4 East Project Ramsay Street Exceedences Recorded for February 2019

Parameter	Time Period	Value of Exceedence	Date of Exceedence
NO ₂ (ppm)	1 hour	-	-
CO (ppm)	8-hour rolling	-	-
PM ₁₀ (µg/m ³)	24-hour	-	-
	Annual	-	-
PM _{2.5} (µg/m ³)	24-hour	-	-
	Annual ¹⁷	-	-

¹⁷ Insufficient data to report annual average, any exceedences will be reported in December 2019.

Table 18: M4 East Project Saint Lukes Park Exceedences Recorded for February 2019

Parameter	Time Period	Value of Exceedence	Date of Exceedence
NO ₂ (ppm)	1 hour	-	-
CO (ppm)	8-hour rolling	-	-
PM ₁₀ (µg/m ³)	24-hour	-	-
	Annual	-	-
PM _{2.5} (µg/m ³)	24-hour	-	-
	Annual ¹⁸	-	-

¹⁸ Insufficient data to report annual average, any exceedences will be reported in December 2019.

5.3. Tabulated data

5.3.1. Annual average

Table 19 displays monthly averages of the PM_{2.5} and PM₁₀ parameters collected at M4 East project ambient air monitoring stations for 2019. Averages shown are for the 2019 calendar year, up to the current reported month. Table requires at least 75% valid data to display a monthly average. Footer values are based on all available data for 2019 rather than the average of individual months. This gives an indication of performance against the annual objectives.

Table 19: PM₁₀ and PM_{2.5} averages at the WestConnex M4 ambient air monitoring stations 2019

Month	Allen Street		Concord Oval		Haberfield school		Powells Creek		Ramsay Street		Saint Lukes Park	
	PM ₁₀ (µg/m ³)	PM _{2.5} (µg/m ³)	PM ₁₀ (µg/m ³)	PM _{2.5} (µg/m ³)	PM ₁₀ (µg/m ³)	PM _{2.5} (µg/m ³)	PM ₁₀ (µg/m ³)	PM _{2.5} (µg/m ³)	PM ₁₀ (µg/m ³)	PM _{2.5} (µg/m ³)	PM ₁₀ (µg/m ³)	PM _{2.5} (µg/m ³)
Jan/19	24.6	10	26.1	9	24.2	13	30.1	12	27.4	11	23.9	9
Feb/19	20.1	6	21.7	5	21.2	7	24.5	7	24.0	7	18.7	6
Average	22.5	8.5	24.0	7.4	22.8	10.2	27.5	9.4	25.8	8.9	21.4	7.6

5.4. Graphic Representations

This section displays graphs of the pollutants and meteorological parameters monitored at the M4 East sites for February 2019. The graphs are based on validated 5 minutes or 1-hour data as appropriate.

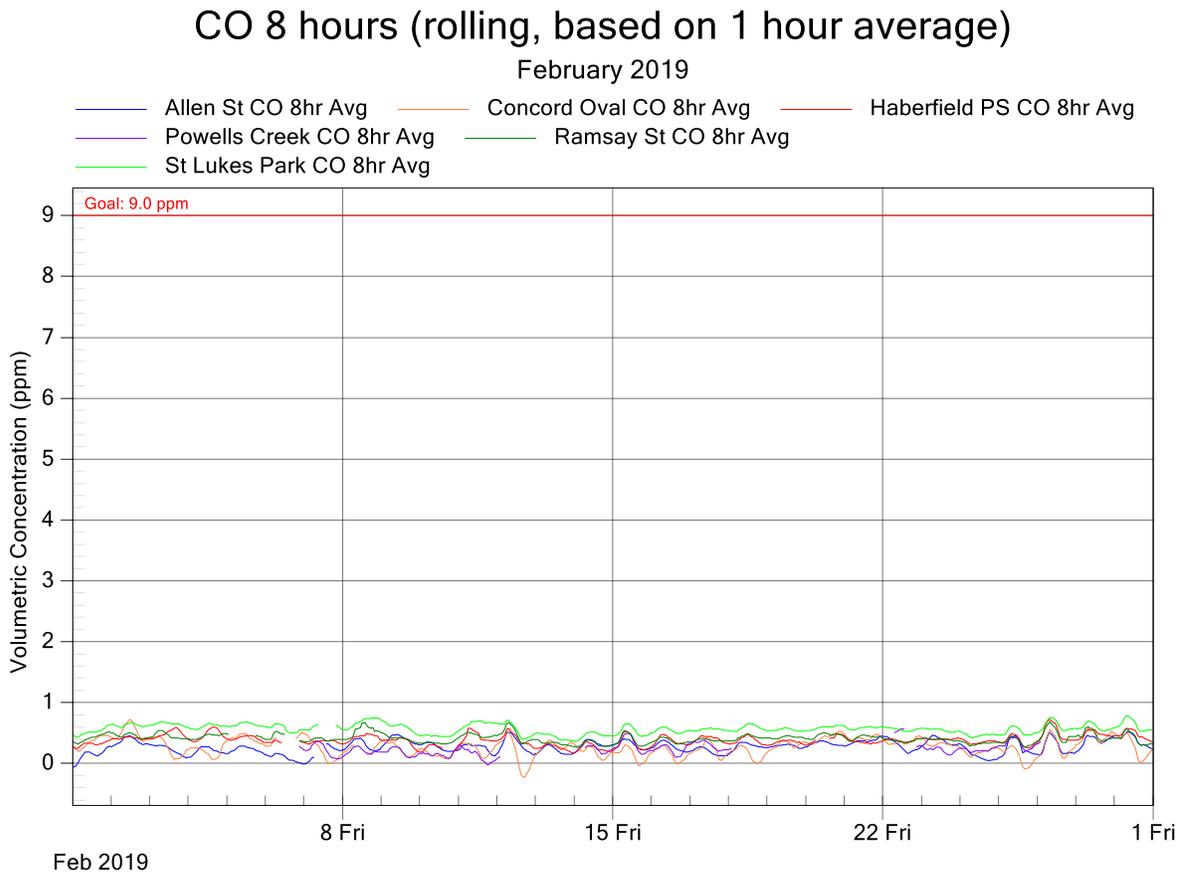


Figure 2: M4 East Project Air Monitoring Stations - CO 8 hours Rolling graph for February 2019

NO₂ 1 hour average

February 2019

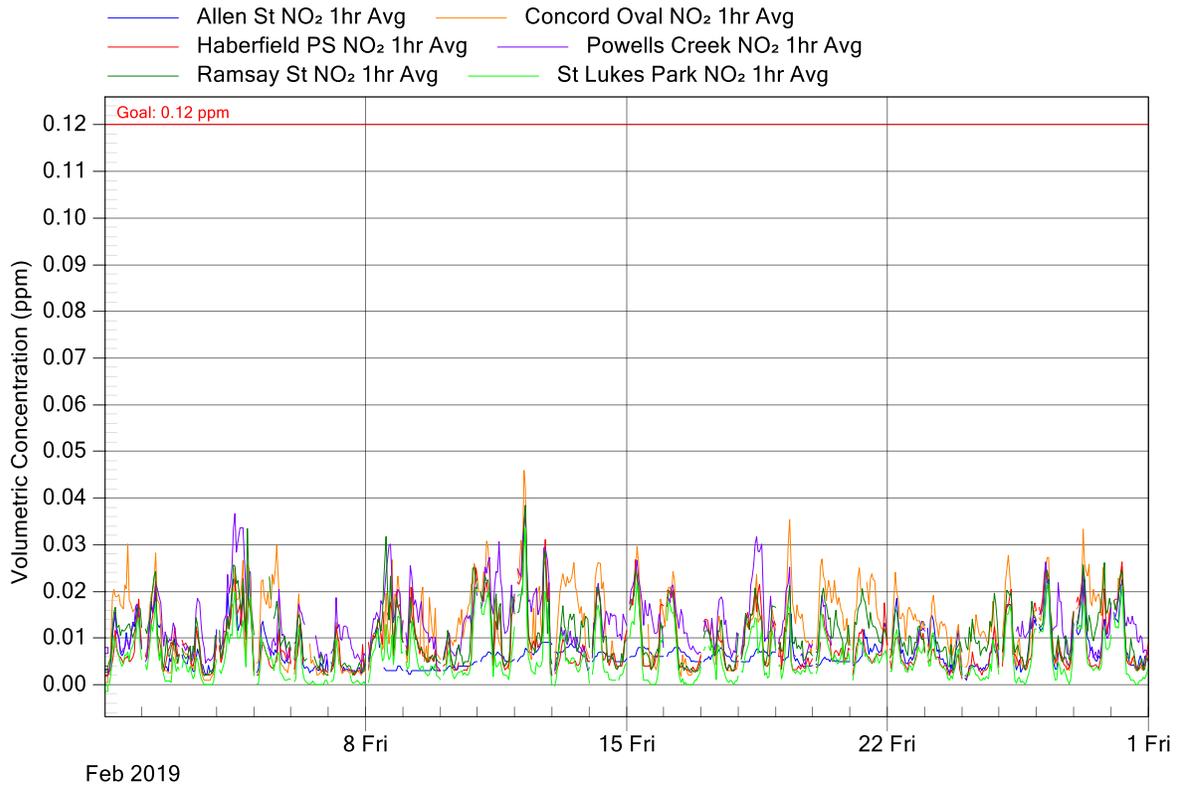


Figure 3: M4 East Project Air Monitoring Stations - NO₂ graph for February 2019

PM₁₀ 24 hour average

February 2019

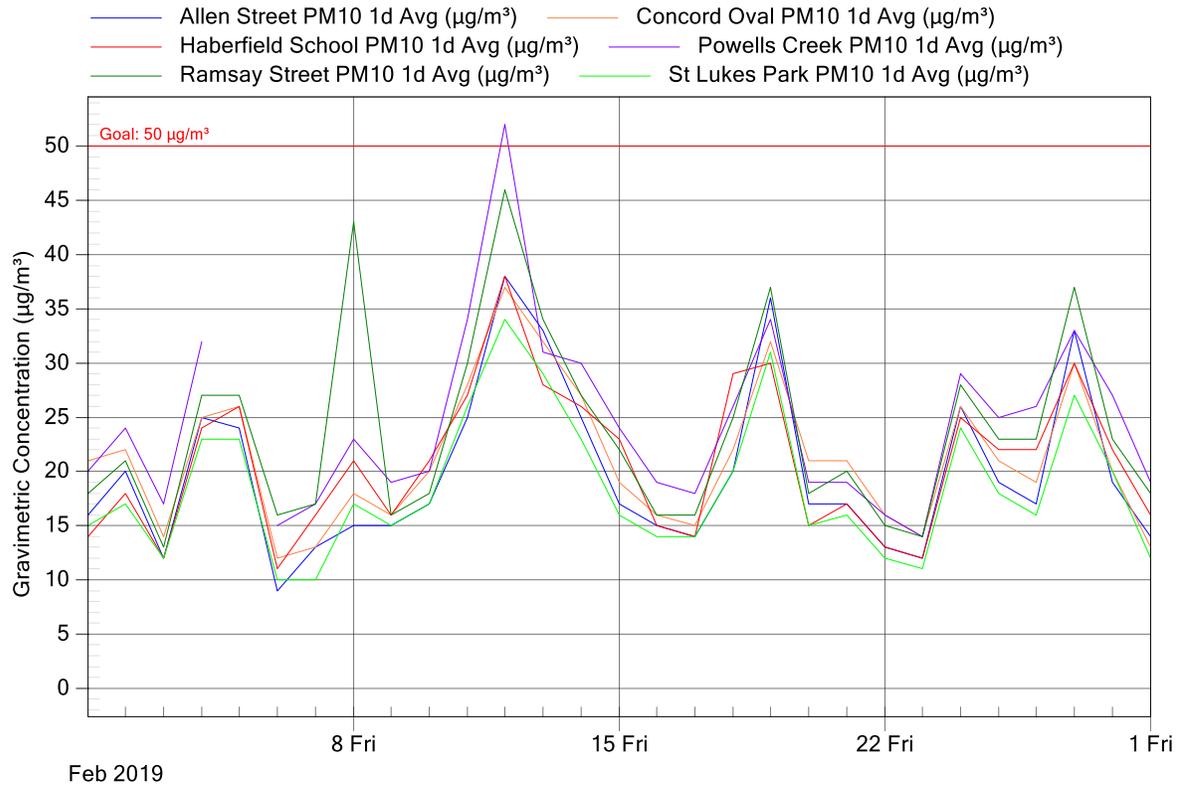


Figure 4: M4 East Project Air Monitoring Stations - PM₁₀ 24 Hour graph for February 2019

PM_{2.5} 24 hour average

February 2019

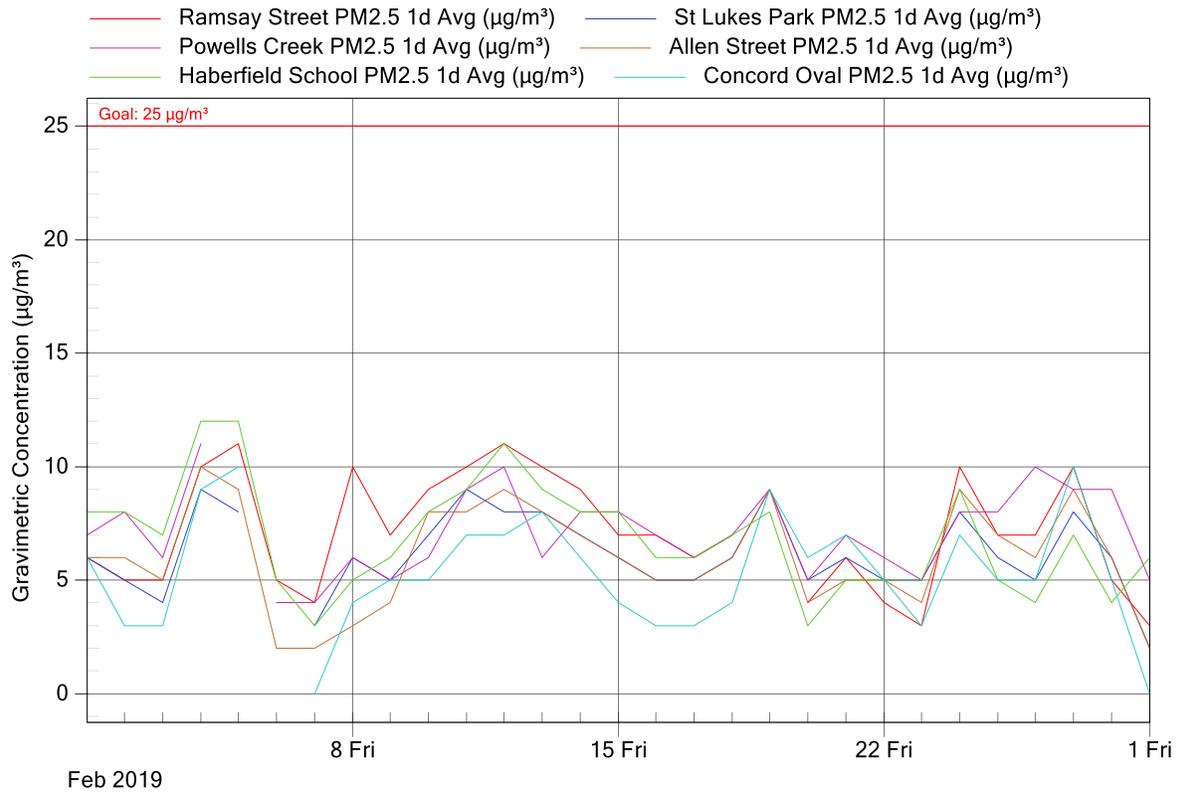


Figure 5: M4 East Project Air Monitoring Stations - PM_{2.5} 24 Hour graph February 2019


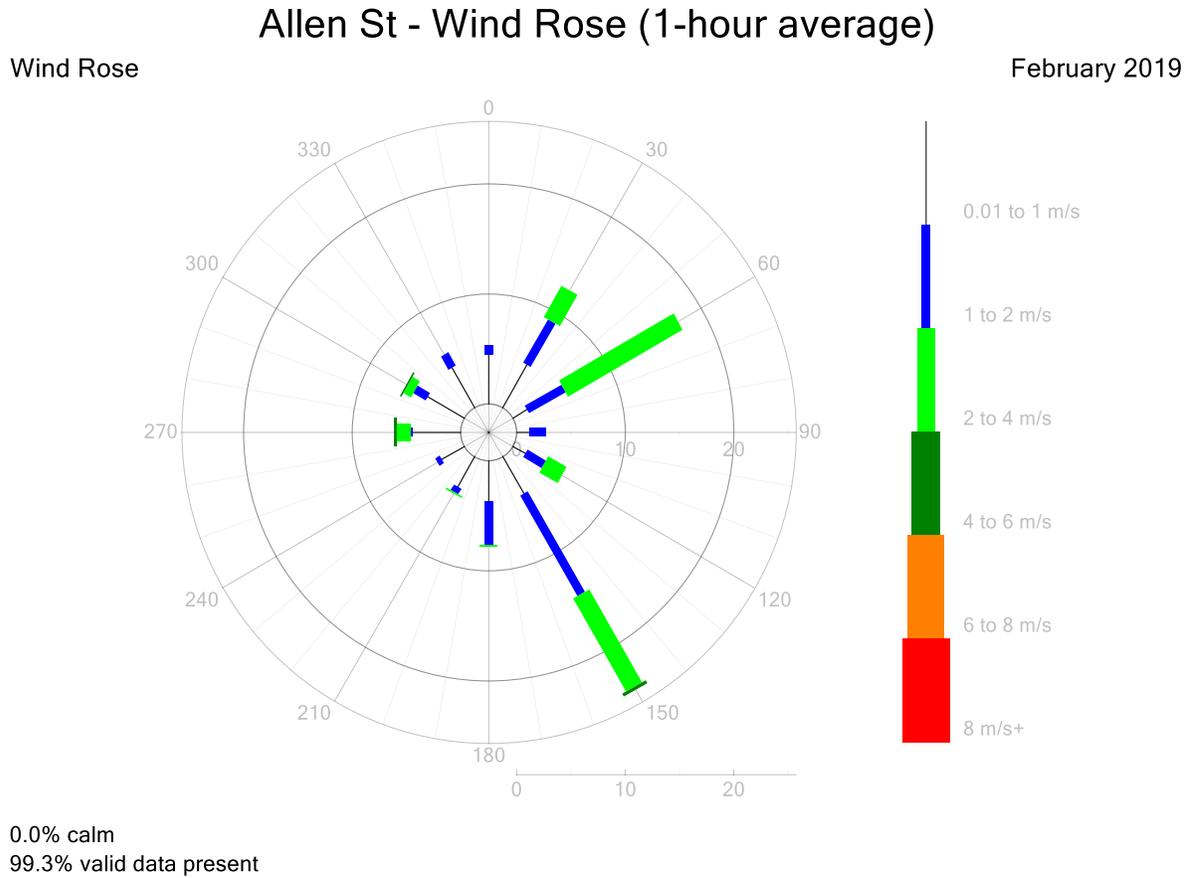


Figure 6: Allen Street – Wind Rose for February 2019

Concord Oval - Wind Rose (1-hour average)

Wind Rose

February 2019

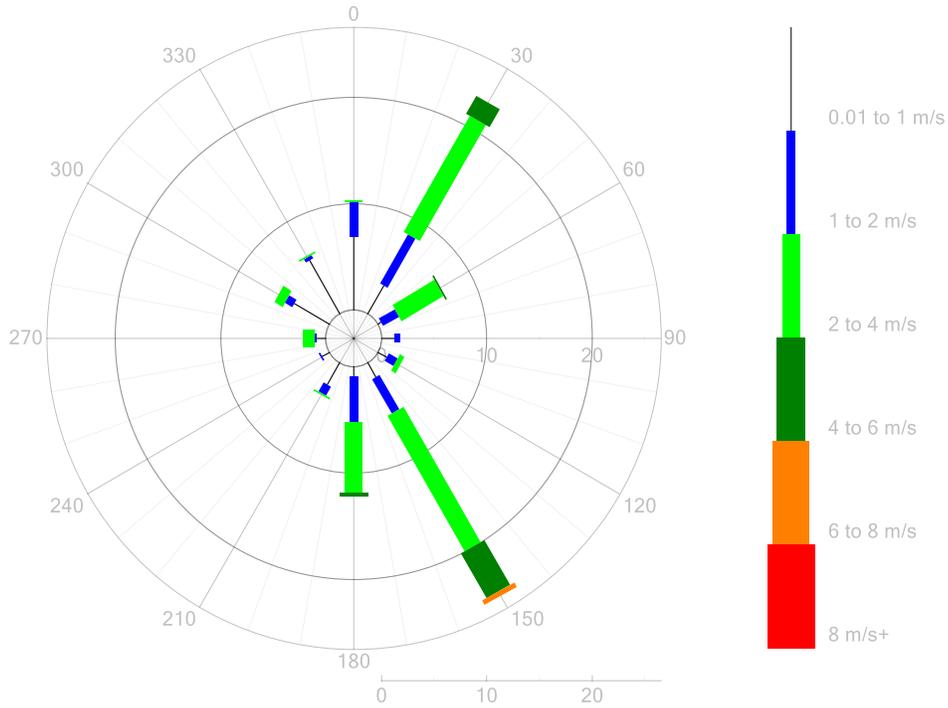


0.0% calm
93.2% valid data present

Figure 7: Concord Oval – Wind Rose for February 2019

Haberfield Public School - Wind Rose (1-hour average)

Wind Rose

February 2019

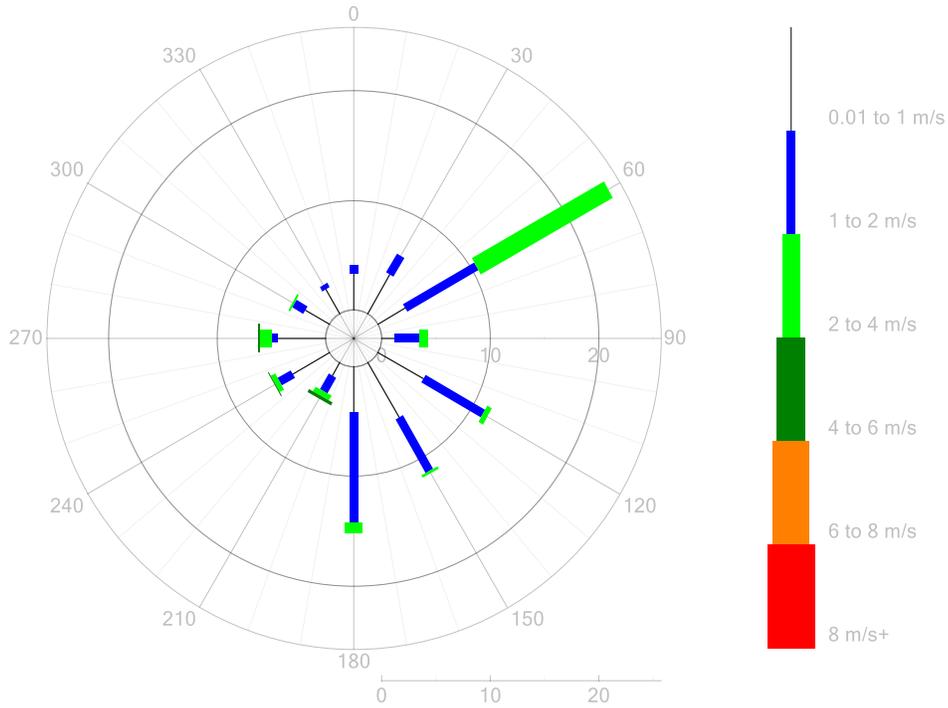

0.0% calm
98.5% valid data present

Figure 8: Haberfield Public School – Wind Rose for February 2019


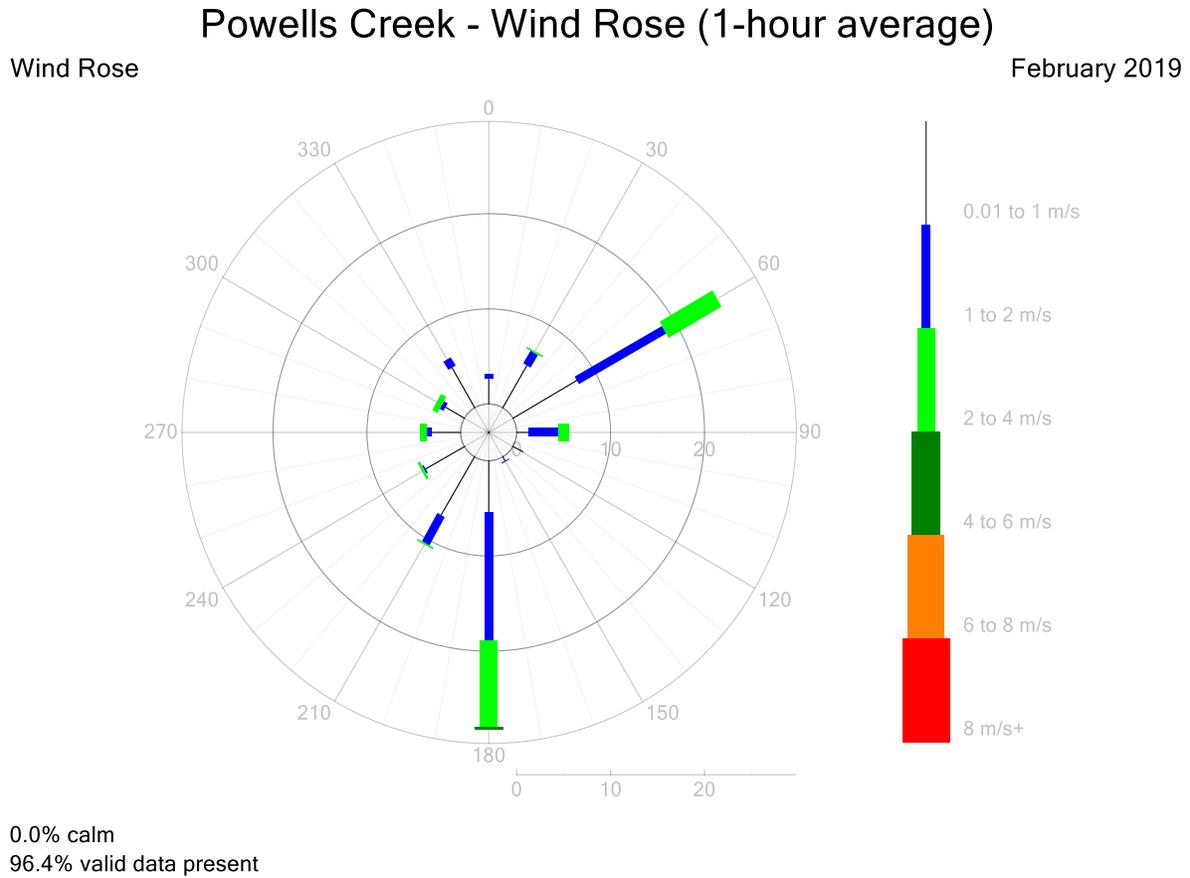


Figure 9: Powells Creek – Wind Rose for February 2019

Ramsay St - Wind Rose (1-hour average)

Wind Rose

February 2019

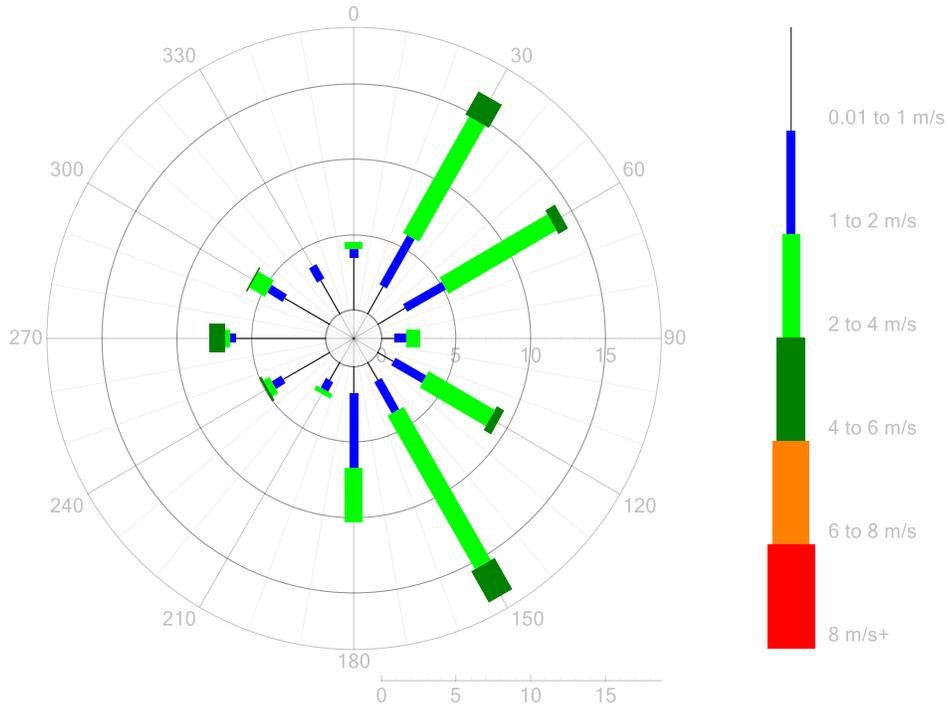


0.1% calm
99.4% valid data present

Figure 10: Ramsay Street – Wind Rose for February 2019

St Lukes Park - Wind Rose (1-hour average)

Wind Rose

February 2019

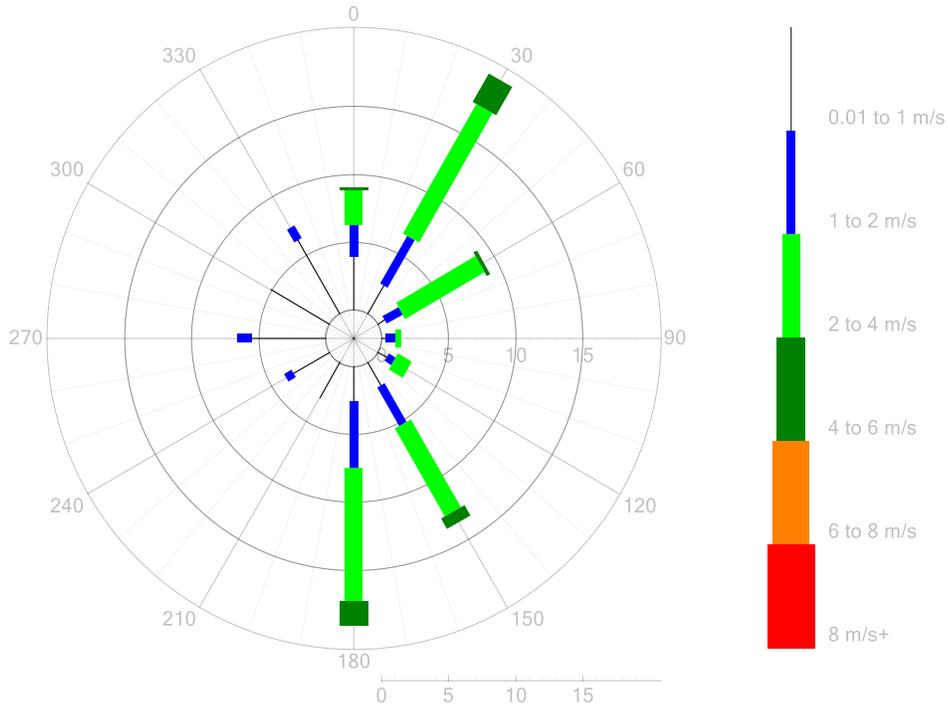

0.0% calm
100.0% valid data present

Figure 11: Saint Lukes Park – Wind Rose for February 2019

6.0 Valid Data Exception Tables

Tables 20 to 25 below detail all changes made to the raw data set during the validation process. An explanation of reasons given in the table can be found in Appendix 2.

Table 20: Allen Street Valid Data Exception Table

Start Date	End Date	Reason	Change Details	User Name	Change Date
01/02/19 01:00	28/02/19 01:30	Automatic span and zero checks once daily for 30 - 35 minutes	CO, NO, NO ₂ , NO _x	AA	8/03/2019
01/02/19 02:55	28/02/19 08:30	Intermittent unrealistic data - Readings not tracking with other sites	AT 2m	AA	8/03/2019
01/02/19 23:50	28/02/19 23:50	Background checks once daily for 5 - 10 minutes	CO	AA	8/03/2019
02/02/19 01:30	02/02/19 23:45	Static offset of 0.38ppm applied to correct baseline drift	CO	AA	8/03/2019
06/02/19 18:50	06/02/19 18:50	Unrealistic negative readings	NO, NO ₂ , NO _x	AA	8/03/2019
07/02/19 05:00	07/02/19 11:30	Scheduled maintenance followed by instrument stabilisation	All parameters	AA	8/03/2019
08/02/19 00:00	15/02/19 00:00	Intermittent instrument fault - flow fault	PM _{2.5}	AA	8/03/2019
08/02/19 10:00	08/02/19 11:40	Unscheduled maintenance	All parameters	AA	8/03/2019
10/02/19 05:45	18/02/19 10:45	Intermittent suspected brief power interruptions	CO, NO, NO ₂ , NO _x , PM ₁₀ , AT 2m, AT 10m, WS, WD, Sigma	AA	8/03/2019
11/02/19 10:20	25/02/19 13:30	Intermittent data transmission errors	CO, NO, NO ₂ , NO _x , PM ₁₀ , AT 2m, AT 10m, WS, WD, Sigma	AA	8/03/2019
15/02/19 10:15	15/02/19 11:10	Unscheduled maintenance followed by instrument stabilisation	CO, NO, NO ₂ , NO _x , PM ₁₀ , AT 2m, AT 10m, WS, WD, Sigma	AA	8/03/2019
25/02/19 01:35	25/02/19 09:10	Linear offset of A= -0.20ppm and B= 0.60ppm applied to correct baseline drift	CO	AA	8/03/2019
25/02/19 09:15	25/02/19 15:30	Intermittent additional background checks	CO	AA	8/03/2019

Start Date	End Date	Reason	Change Details	User Name	Change Date
25/02/19 09:25	25/02/19 14:10	Linear offset of A= -0.00ppm and B= 1.90ppm applied to correct baseline drift	CO	AA	8/03/2019
25/02/19 14:30	25/02/19 23:40	Linear offset of A= -0.20ppm and B= 1.45ppm applied to correct baseline drift	CO	AA	8/03/2019
26/02/19 01:35	26/02/19 12:30	Linear offset of A= -0.00ppm and B= 0.50ppm applied to correct baseline drift	CO	AA	8/03/2019
26/02/19 12:35	26/02/19 13:45	Unscheduled maintenance	CO	AA	8/03/2019
27/02/19 01:35	27/02/19 23:40	Linear offset of A= -0.00ppm and B= 0.50ppm applied to correct baseline drift	CO	AA	8/03/2019
28/02/19 01:35	28/02/19 23:40	Linear offset of A= -0.35ppm and B= 0.54ppm applied to correct baseline drift	CO	AA	8/03/2019

Table 21: Concord Oval Valid Data Exception Table

Start Date	End Date	Reason	Change Details	User Name	Change Date
01/02/19 01:00	28/02/19 01:35	Automatic span and zero checks once daily for 30 - 40 minutes	CO, NO, NO ₂ , NO _x	AA	13/03/2019
01/02/19 23:45	28/02/19 23:50	Background checks once daily for 5 - 10 minutes	CO	AA	13/03/2019
02/02/19 17:35	28/02/19 10:50	Intermittent data transmission errors	CO, NO, NO ₂ , NO _x , PM ₁₀	AA	13/03/2019
05/02/19 00:50	26/02/19 18:45	Intermittent unrealistic negative readings	NO, NO ₂ , NO _x	AA	13/03/2019
06/02/19 06:00	06/02/19 13:30	Scheduled maintenance followed by instrument stabilisation	All parameters	AA	13/03/2019
06/02/19 18:00	06/02/19 19:00	Instrument fault - flow fault	PM _{2.5}	AA	13/03/2019
08/02/19 07:00	08/02/19 09:25	Unscheduled maintenance performed	All parameters	AA	13/03/2019
10/02/19 10:00	11/02/19 09:00	Intermittent Beta data gaps manually filled up according to 5-minute readings	PM _{2.5}	AA	13/03/2019
10/02/19 22:05	27/02/19 10:00	Intermittent logger faults - Only CO, NO, NO ₂ , NO _x , PM ₁₀ and PM _{2.5} data was recoverable directly from the instruments	WS, WD, Sigma, AT10m, AT2m	AA	13/03/2019
11/02/19 10:30	11/02/19 10:45	Unscheduled maintenance performed	WS, WD, Sigma, PM ₁₀	AA	13/03/2019
15/02/19 12:20	15/02/19 13:30	Unscheduled maintenance performed	NO, NO ₂ , NO _x	AA	13/03/2019
19/02/19 12:25	19/02/19 12:55	Unscheduled maintenance performed	WS, WD, Sigma, PM ₁₀	AA	13/03/2019
21/02/19 08:30	21/02/19 10:55	Unscheduled maintenance performed	NO, NO ₂ , NO _x	AA	13/03/2019
22/02/19 14:50	22/02/19 14:55	Additional background check	CO	AA	13/03/2019
26/02/19 14:00	26/02/19 15:35	Unscheduled maintenance performed	WS, WD, Sigma, PM ₁₀ , PM _{2.5}	AA	13/03/2019

Table 22: Haberfield Public School Valid Data Exception Table

Start Date	End Date	Reason	Change Details	User Name	Change Date
1/02/2019 1:00	28/02/2019 1:25	Automatic span and zero checks once daily for 25 - 35minutes	CO, NO, NO ₂ , NO _x	AA	14/03/2019
1/02/2019 5:15	1/02/2019 5:30	Unrealistic negative readings	PM ₁₀	AA	14/03/2019
1/02/2019 6:25	28/02/2019 15:25	Intermittent data transmission errors	CO, NO, NO ₂ , NO _x , WS, WD, Sigma	AA	14/03/2019
1/02/2019 23:45	28/02/2019 23:45	Background checks once daily for 10 - 15 minutes	CO	AA	14/03/2019
6/02/2019 9:00	6/02/2019 16:45	Scheduled maintenance	All parameters	AA	14/03/2019
6/02/2019 16:00	25/02/2019 11:00	Offset of -3.9µg/m ³ applied to correct instrument zero based on incorrect reference value being reported as entered in the instrument during the site visit on 06/02/2019	PM _{2.5}	AA	14/03/2019
6/02/2019 16:45	6/02/2019 23:40	Static offset of -1.00ppm applied to correct baseline drift	CO	AA	14/03/2019
6/02/2019 23:55	10/02/2019 12:55	Static offset of -0.60ppm applied to correct baseline drift	CO	AA	14/03/2019
7/02/2019 0:00	15/02/2019 0:00	Intermittent instrument fault - Flow fault, followed by instrument stabilisation	PM _{2.5}	AA	14/03/2019
7/02/2019 12:20	7/02/2019 12:50	Unscheduled remote maintenance	CO, NO, NO ₂ , NO _x	AA	14/03/2019
8/02/2019 13:00	8/02/2019 14:10	Unscheduled maintenance	All parameters	AA	14/03/2019
10/02/2019 13:00	10/02/2019 15:10	Unscheduled remote maintenance	CO, NO, NO ₂ , NO _x	AA	14/03/2019
10/02/2019 23:40	10/02/2019 23:50	Suspected brief power interruption	CO, NO, NO ₂ , NO _x , WS, WD, Sigma, AT2m, AT10m, PM ₁₀	AA	14/03/2019
13/02/2019 12:00	24/02/2019 8:00	Intermittent beta data gaps manually filled up according to 5-minute readings	PM _{2.5}	AA	14/03/2019

Start Date	End Date	Reason	Change Details	User Name	Change Date
19/02/2019 11:00	19/02/2019 12:00	Unrealistic readings that do not track with other sites	PM _{2.5}	AA	14/03/2019
20/02/2019 6:00	20/02/2019 9:05	Power failure followed by instrument stabilisation	All parameters	AA	14/03/2019
20/02/2019 9:10	20/02/2019 23:40	Linear offset of A= -0.280ppm and B= -0.730ppm applied to correct baseline drift	CO	AA	14/03/2019
22/02/2019 12:45	22/02/2019 12:55	Additional background check	CO	AA	14/03/2019
25/02/2019 9:55	25/02/2019 14:00	Unscheduled maintenance - BAM1020 instrument swapped out (IN: 16-0176, OUT: 17-2424)	CO, NO, NO ₂ , NO _x , PM _{2.5}	AA	14/03/2019

Table 23: Powells Creek Valid Data Exception Table

Start Date	End Date	Reason	Change Details	User Name	Change Date
01/02/19 00:00	04/02/19 20:20	Readings became unstable and instrument was found out of calibration during maintenance visit	CO	AA	12/03/2019
01/02/19 01:00	28/02/19 01:30	Automatic span and zero check, once daily for 30 - 35 minutes	CO, NO, NO ₂ , NO _x	AA	12/03/2019
01/02/19 15:30	28/02/19 15:35	Background checks, once daily for 5 - 15 minutes	CO	AA	12/03/2019
01/02/19 22:20	28/02/19 08:30	Intermittent unrealistic data - Readings not tracking with other sites	AT 10m, AT 2m	AA	12/03/2019
02/02/19 22:35	28/02/19 03:45	Intermittent data transmission errors	NO, NO ₂ , NO _x	AA	12/03/2019
04/02/19 12:00	27/02/19 11:00	Intermittent power interruptions followed by instrument stabilisation	All parameters	AA	12/03/2019
04/02/19 20:00	05/02/19 08:50	Power interruption due to third party electric works, followed by instrument stabilisation	All parameters	AA	12/03/2019
05/02/19 08:35	05/02/19 10:15	Instrument fault	PM ₁₀	AA	12/03/2019
05/02/19 08:55	06/02/19 10:05	Readings became unstable and instrument was found out of calibration during maintenance visit	CO	AA	12/03/2019
05/02/19 10:20	05/02/19 10:50	Unscheduled maintenance - instrument fault fixed	PM ₁₀	AA	12/03/2019
05/02/19 13:10	05/02/19 13:10	Unrealistic negative reading	NO, NO ₂ , NO _x	AA	12/03/2019
06/02/19 09:00	06/02/19 15:45	Scheduled maintenance performed	All parameters	AA	12/03/2019
09/02/19 15:40	10/02/19 00:55	Static offset of 0.400ppm applied to correct baseline drift	CO	AA	12/03/2019
10/02/19 01:40	11/02/19 00:55	Static offset of 0.250ppm applied to correct baseline drift	CO	AA	12/03/2019
12/02/19 01:35	14/02/19 00:55	Instrument fault - automatic calibration out of tolerance	CO	AA	12/03/2019
14/02/19 01:40	16/02/19 15:25	Static offset of 0.500ppm applied to correct baseline drift	CO	AA	12/03/2019

Start Date	End Date	Reason	Change Details	User Name	Change Date
18/02/19 01:35	20/02/19 12:55	Instrument fault - automatic zero check out of tolerance	CO	AA	12/03/2019
20/02/19 13:00	20/02/19 13:35	Unscheduled maintenance	CO, NO, NO ₂ , NO _x	AA	12/03/2019
20/02/19 13:40	20/02/19 22:00	Additional stabilisation following unscheduled maintenance	NO, NO ₂ , NO _x	AA	12/03/2019
20/02/19 13:40	22/02/19 00:55	Instrument fault - automatic calibration out of tolerance	CO	AA	12/03/2019
20/02/19 22:05	22/02/19 12:45	Instrument fault - automatic calibration out of tolerance	NO, NO ₂ , NO _x	AA	12/03/2019
22/02/19 12:00	22/02/19 15:40	Unscheduled maintenance followed by instrument stabilisation	All parameters	AA	12/03/2019
23/02/19 01:35	25/02/19 09:40	Instrument fault - automatic calibration out of tolerance	NO, NO ₂ , NO _x	AA	12/03/2019
23/02/19 15:40	24/02/19 09:10	Static offset of 0.600ppm applied to correct baseline drift	CO	AA	12/03/2019
24/02/19 09:15	24/02/19 09:50	Additional background check	CO	AA	12/03/2019
24/02/19 15:40	25/02/19 15:25	Static offset of -0.600ppm applied to correct baseline drift	CO	AA	12/03/2019
25/02/19 09:45	25/02/19 10:20	Unscheduled remote maintenance followed by instrument stabilisation	CO, NO, NO ₂ , NO _x	AA	12/03/2019
25/02/19 15:40	26/02/19 00:55	Static offset of -1.000ppm applied to correct baseline drift	CO	AA	12/03/2019
26/02/19 01:40	27/02/19 08:15	Instrument fault - automatic zero check out of tolerance	CO	AA	12/03/2019
27/02/19 10:30	01/03/19 00:00	Instrument fault	CO	AA	12/03/2019

Table 24: Ramsay Street Valid Data Exception Table

Start Date	End Date	Reason	Change Details	User Name	Change Date
01/02/19 01:00	28/02/19 01:40	Automatic span and zero checks, once daily for 40 - 45 minutes	CO, NO, NO ₂ , NO _x	AA	14/03/2019
01/02/19 03:35	27/02/19 04:30	Intermittent data transmission errors	CO, NO, NO ₂ , NO _x , AT2m, AT10m, WS, WD, Sigma, PM ₁₀	AA	14/03/2019
01/02/19 23:45	28/02/19 23:55	Background checks, once daily for 5 - 10 minutes	CO	AA	14/03/2019
03/02/19 09:15	28/02/19 10:35	Intermittent unrealistic negative readings	NO, NO ₂ , NO _x	AA	14/03/2019
05/02/19 01:40	05/02/19 09:10	Instrument fault - instrument stuck in calibration mode	CO, NO, NO ₂ , NO _x	AA	14/03/2019
05/02/19 09:15	05/02/19 11:55	Unscheduled maintenance performed - instrument fault fixed	CO, NO, NO ₂ , NO _x	AA	14/03/2019
05/02/19 12:00	05/02/19 14:20	Scheduled maintenance commenced followed by instrument stabilisation	CO, NO, NO ₂ , NO _x , PM ₁₀ , PM _{2.5}	AA	14/03/2019
06/02/19 11:00	06/02/19 14:55	Scheduled maintenance continued, followed by instrument stabilisation	All parameters	AA	14/03/2019
06/02/19 16:10	25/02/19 10:05	Intermittent additional background checks	CO	AA	14/03/2019
07/02/19 00:00	15/02/19 00:00	Intermittent instrument fault - flow fault	PM _{2.5}	AA	14/03/2019
07/02/19 06:15	07/02/19 07:15	Scheduled maintenance continued	NO, NO ₂ , NO _x	AA	14/03/2019
18/02/19 22:00	19/02/19 12:00	Instrument fault - tape fault	PM _{2.5}	AA	14/03/2019
19/02/19 13:00	19/02/19 13:00	Unscheduled maintenance performed - tape fault fixed	PM _{2.5}	AA	14/03/2019

Table 25: Saint Lukes Park Valid Data Exception Table

Start Date	End Date	Reason	Change Details	User Name	Change Date
01/02/19 01:00	28/02/19 01:40	Automatic span and zero checks, once daily for 40 - 50 minutes	CO, NO, NO ₂ , NO _x	AA	14/03/2019
01/02/19 17:10	28/02/19 13:05	Intermittent data transmission errors	CO, NO, NO ₂ , NO _x , WS, WD, Sigma, AT 2m, AT 10m, PM ₁₀	AA	14/03/2019
01/02/19 23:45	28/02/19 23:50	Background checks, once daily for 5 - 15 minutes	CO	AA	14/03/2019
06/02/19 12:00	07/02/19 05:00	Scheduled maintenance commenced	PM _{2.5}	AA	14/03/2019
07/02/19 08:30	07/02/19 13:55	Scheduled maintenance continued, followed by instrument stabilisation	CO, NO, NO ₂ , NO _x , WS, WD, Sigma, AT 2m, AT 10m, PM ₁₀	AA	14/03/2019
07/02/19 16:30	07/02/19 16:30	Additional background check	CO	AA	14/03/2019
14/02/19 18:10	14/02/19 18:25	Suspected brief power interruption	CO, NO, NO ₂ , NO _x , WS, WD, Sigma, AT 2m, AT 10m, PM ₁₀	AA	14/03/2019

7.0 Report Summary

- Percentage availability for some parameters at M4 East Project was below 95%, refer to Table 12, and Tables 20-25 for details.
- There was one PM₁₀ recorded reading over the Exceedence Levels for the reporting period. Please refer to Tables 13-18 in Section 5.2 – Air Quality Monthly Summary for further information.

Appendix 1 - Definitions & Abbreviations

ERS	Environmental Reporting Services
AQMS	Air Quality Monitoring Station
AQM	Air Quality Monitor
BAM	Beta Attenuation Monitors
TEOM	Tapered Element Oscillating Microbalance
°	Degrees (True North)
K	Kelvin
µg/m ³	Micrograms per cubic metre at standard temperature and pressure (0°C and 101.3 kPa)
AT	Ambient Temperature
calm	Wind conditions where the wind speed is below the operating range of the wind sensor
CO	Carbon monoxide
mg/m ³	Milligrams per cubic metre at standard temperature and pressure (0°C and 101.3 kPa)
mm	Millimeters
NO	Nitric oxide
NO ₂	Nitrogen dioxide
NO _x	Oxides of nitrogen
PM ₁₀	Particulate less than 10 microns in equivalent aerodynamic diameter
PM _{2.5}	Particulate less than 2.5 microns in equivalent aerodynamic diameter
ppb	Parts per billion

ppm	Parts per million
RH	Relative Humidity
WD	Vector Wind Direction
WS	Vector Wind Speed

Appendix 2 - Explanation of Exception Table

Automatic filter tape advance refers to the movement of the filter paper by the analyser to an unused spot.

Automatic background check refers to when analyser samples zero air and measures the level of the concentration voltage. This voltage is taken as the zero signal level and this value is subtracted from any subsequent readings as an active zero compensation. This is the analyser's fine zero measurement.

Automatic span/zero check. The E-Sampler is programmed to perform a zero calibration check whereby air is passed through filter element, removing particulates, before entering the sensor in the analyser. Data is invalidated when these checks occur.

Beta count failure refers to a fault in the functioning of the EBAM. A one minute beta count was less than the maximum acceptable counts during operation.

Calibration check outside tolerance refers to when the calibration values are outside the tolerance limits set for the precision check.

Calibration correction factor applied to data refers to an offset or multiplier applied to the data. This operation may be performed for a number of reasons including: (a) when a clear trend / drift outside the tolerance limit can be demonstrated by repeated operation precision checks, (b) when a correction is required on previously logged data due to a calibration check being outside the allowable tolerance

Commissioning refers to the initial setup and calibration of the instrument when it is first installed. For some instruments there may be a stabilisation period before normal operation commences.

Data transmission error refers to a period of time when the instrument could not transmit data. This may be due to interference, or a problem with the phone line or modem.

Equipment malfunction/instrument fault refers to a period of time when the instrument was not in the normal operating mode and did not measure a representative value of the existing conditions.

Gap in data/data not available refers to a period of time when either data has been lost or could not be collected.

Instrument Alarm refers to an alarm produced by the instrument. A range of alarms can be produced depending on how operation of the instrument is being affected.

Instrument out of service refers to a lack of data due to an instrument being shut down for repair, maintenance, or factory calibration.

Linear offset or multiplier refers to when an offset or multiplier has been applied between two points where the values of the offset or multiplier are different and the correction is interpolated between the two points.

Logger error refers to when an error occurs and instrument readings are not correctly recorded by the logger.

Maintenance refers to a period of time when the logger/instrument was switched off due to maintenance.

Overnight span/zero out of tolerance refers to when the span/zero reading measured by the analyser during an automatic precision check falls outside of the expected concentration limits.

Overnight zero out of tolerance refers to when the automatic zero reading measured by the analyser falls outside the expected limits.

Power Interruption refers to no power to the station therefore no data was collected at this time.

Remote Calibration refers to when a technician remotely connects to the station and manually performs a span check.

Static offset or multiplier refers to when a single offset or multiplier has been applied to the data between two points either to increase or decrease the measured value.

Tape break refers to the breaking of the EBAM/BAM sample tape during operation.

Warm up after power interruption refers to the startup period of an instrument after power has been restored.

Comparison of WestConnex M4 East sites with EPA sites

PM10
24 hour average
February 2019

