

Accredited for compliance with ISO/IEC 17025-Testing



Accreditation No. 14184.

# TfNSW – Rozelle Interchange WestConnex 3B Project

# Ambient Air Quality and Weather Monitoring

Validated Report

# 1<sup>st</sup> August 2023 – 31<sup>st</sup> August 2023

Report No.: DAT20290

Report issue date: 28th September 2023

Maintenance contract: MC2242

Acoem Australasia (Ecotech Pty Ltd). ABN: 32005752081 1492 Ferntree Gully Rd, Knoxfield VIC. 3180. AUSTRALIA Tel No: 1300 364 946 Fax No: 1300 668 763 Email: info.au@acoem.com WEB: www.acoem.com.au

This document shall not be reproduced except for in full, without the written approval of Acoem Australasia (Ecotech Pty Ltd).

TfNSW – Rozelle Interchange



Customer Details				
Customer TfNSW – Rozelle Interchange				
Contact name	act name Courtney Moran			
Address	TfNSW – Rozelle Interchange Level 1 33 James Craig Road Rozelle 2039			

Revision History			
Revision Report ID		Date	Analyst
0	DAT20290	28/09/2023	Eddie Quach

Report by:

Eddie Quach

Quanto

**Approved Signatory:** 

Elmira Parto

# Report No: DAT20290

TfNSW – Rozelle Interchange



# Table of Contents

Customer Details2
Revision History2
Table of Contents
List of Figures4
List of Tables4
Executive Summary6
Report Summary6
1.0 Introduction7
2.0 Monitoring and Data Collection7
2.1. Siting Details7
2.2. Monitored Parameters9
2.3. Data Collection Methods10
2.3.1. NATA Endorsement and Conformity with Standards11
2.3.2. Data Acquisition11
2.4. Data Validation and Reporting12
2.4.1. Validation
2.4.2. Reporting12
3.0 Air Quality Goals
4.0 Calibrations and Maintenance15
4.1. Units and Uncertainties15
4.2. Maintenance
4.2.1. Calibration & Maintenance Summary Tables17
5.0 Results

# Report No: DAT20290

TfNSW – Rozelle Interchange



5.1.	Data Capture
5.2.	Air Quality Monthly Summary23
5.3.	Tabulated data
5.3.1.	Annual average27
5.4.	Graphic Representations
6.0 V	alid Data Exception Tables
7.0 R	eport Summary
Appendix	40 4 Contract of the second s
Appendix	42 - Explanation of Exception Table

## List of Figures

Figure 1: WCX 3B Project Monitoring Station Locations	8
Figure 2: WCX 3B Project Air Monitoring Stations - CO 8-Hour Rolling Graph for August 2023	28
Figure 3: WCX 3B Project Air Monitoring Stations - NO <sub>2</sub> 1-Hour Averages Graph for August 2023	29
Figure 4: WCX 3B Project Air Monitoring Stations - PM <sub>10</sub> 24-Hour Averages Graph for August 2023	30
Figure 5: WCX 3B Project Air Monitoring Stations - PM <sub>2.5</sub> 24-Hour Averages Graph for August 2023	31
Figure 6: WCX Quirk Street - Wind Rose of August 2023	32
Figure 7:WCX Chapman Road - Wind Rose of August 2023	33
Figure 8:WCX Manning Street - Wind Rose of August 2023	34
Figure 9:WCX Bridgewater Park - Wind Rose of August 2023	35

#### List of Tables

Table 1: WCX 3B Project monitoring sites' locations    7	'
Table 2: Parameters measured at the WCX – 3B monitoring stations9	)

# Report No: DAT20290



Table 3: Methods
Table 4: Automatic Span / Zero/ Stabilization and Background checks at WestConnex 3B stations
Table 5: WestConnex 3B Project - Air Quality Goals14
Table 6: Units and Uncertainties
Table 7: WCX Quirk Street Maintenance Table - August 2023       17
Table 8: WCX Chapman Road Maintenance Table August 2023       18
Table 9: WCX Manning Street Maintenance Table August 2023
Table 10: WCX Bridgewater Park Maintenance Table August 2023       20
Table 11: Data Capture for WCX 3B Project Ambient Air Quality Network       22
Table 12: WCX Quirk Street Exceedances Recorded for August 2023
Table 13: WCX Chapman Road Exceedances Recorded for August 2023
Table 14: WCX Manning Street Exceedances Recorded for August 2023       25
Table 15: WCX Bridgewater Park Exceedances Recorded for August 2023       26
Table 16: $PM_{10}$ and $PM_{2.5}$ averages at the WCX 3B ambient air monitoring stations 202327
Table 17: WCX Quirk Street Valid Data Exception Table
Table 18: WCX Chapman Road Valid Data Exception Table       36
Table 19: WCX Manning Street Valid Data Exception Table       37
Table 20: WCX Bridgewater Park Valid Data Exception Table       38

#### **Report No: DAT20290**

TfNSW – Rozelle Interchange



#### **Executive Summary**

The Rozelle Interchange and Iron Cove Link will provide a new underground motorway interchange to City West Link and provide an underground bypass of Victoria Road between the Iron Cove Bridge and the ANZAC Bridge, with links to the approved Western Harbour Tunnel.

The interchange in Rozelle will be mostly underground and located at the site of the old Rozelle Rail Yards.

This Report details ambient air measurements. It is part of the commitment to the Minister and the community to report air quality measurements in real-time (raw data as the measurements occur) as well as validated reports. It is important to re-publish the data in reports because the raw data needs to be checked and collated by approved air quality experts and 'translated' into a format that is easy to understand and can be interpreted by both experts and laypeople.

This report details results at four external ambient air quality monitoring stations located at Quirk Street, Chapman Road, Manning Street and Bridgewater Park between 1<sup>st</sup> August 2023 and 31st August 2023.

#### **Report Summary**

Percentage availability for all parameters at the WestConnex 3B Ambient Air Quality Monitoring Network was above 95% during the reporting month except for  $PM_{10}$  data capture of Chapman Road station and  $PM_{10}$  data capture of Bridgewater Park station that were mainly due to instrument fault and maintenance. Please refer to Table 11, and Tables 17-20 for details.

There were no exceedance of the air quality goals at the WestConnex 3B Ambient Air Quality Monitoring station for the reporting month. Please refer to Tables 12-15 in Section 5.2 – Air Quality Monthly Summary for further information.

#### **Report No: DAT20290**

TfNSW – Rozelle Interchange



#### **1.0** Introduction

Acoem Australasia (Ecotech) was commissioned by TfNSW – Rozelle Interchange to provide monitoring and data reporting for the WCX 3B Project ambient air quality and weather monitoring network, located as detailed in Table 1. Acoem Australasia (Ecotech) commenced data collection in October 2022.

This report presents the available data for August 2023.

The data presented in this report:

- Describes air quality measurements;
- Compares monitoring results;
- Has been quality assured;
- Complies with NATA accreditation requirements, where applicable.

## 2.0 Monitoring and Data Collection

#### 2.1. Siting Details

The WCX 3B Project monitoring network consists of four ambient air quality and weather monitoring stations. The stations' location and siting details are described below.

#### Table 1: WCX 3B Project monitoring sites' locations

Site Name	Geographical Coordinates	Height Above Sea Level (m)	
Quirk Street	33°52'00.3"S, 151°10'18.0"E	23	
Chapman Road	33°52'20.8"S, 151°10'29.5"E	6	
Manning Street	33°51'50.1"S, 151°09'25.2"E	15	
Bridgewater Park	33°51'33.9"S, 151°09'58.1"E	9	

#### **Report No: DAT20290**

TfNSW – Rozelle Interchange



A siting audit to assess sites for compliance with *AS/NZS 3580.1.1:2016* and *AS/NZS 3580.14:2014* have been completed as follows:

- Quirk Street on 26/10/2022
- Chapman Road on 03/11/2022
- Manning Street on 19/10/2022
- Bridgewater Park on 01/11/2022



Figure 1: WCX 3B Project Monitoring Station Locations

TfNSW – Rozelle Interchange



#### 2.2. Monitored Parameters

Tables 2 below detail the parameters monitored and the instruments used at the WCX 3B Project monitoring stations. Appendix 1 defines any abbreviated parameter names used throughout the report.

#### Table 2: Parameters measured at the WCX – 3B monitoring stations

Parameter Measured	Instrument and Measurement Technique	Elevation
СО	Acoem Australasia (Ecotech) Serinus 30 – NDIR gas filter correlation infrared photometry	2 m
NO, NO <sub>2</sub> , NO <sub>x</sub>	Acoem Australasia (Ecotech) Serinus 40 – gas phase chemiluminescence	2 m
PM <sub>2.5</sub>	Met One BAM 1020 – Beta ray attenuation	2 m
PM <sub>10</sub>	Thermo – 1405 TEOM (Tapered Element Oscillating Microbalance)	2m
Differential Temperature (Elevation 2m)	Rotronics HC2A-S3 Standard Meteo Probe	2 m
Differential Temperature (Elevation 10m)	Rotronics HC2A-S3 Standard Meteo Probe	10 m
Wind Speed (Horizontal, elevation 10m)	Gill Windsonic Op3	10 m
Wind Direction (Elevation 10m)	Gill Windsonic Op3	10 m
Sigma	Calculation	-

TfNSW – Rozelle Interchange



#### 2.3. Data Collection Methods

Table 3 below shows the methods used for data collection.

#### Table 3: Methods

Parameter Measured	Data Collection Methods Used	Description of Method	
NO, NO <sub>2</sub> , NO <sub>x</sub>	AS 3580.5.1 - 2011	Methods for sampling and analysis of ambient air - Method 5.1: Determination of oxides of nitrogen-Chemiluminescence method	
СО	AS 3580.7.1 - 2011	Methods for sampling and analysis of ambient air. Method 7.1: Determination of carbon monoxide—Direct-reading instrumental method	
PM <sub>10</sub> (TEOM)	AS 3580.9.8-2022	Methods for sampling and analysis of ambient air. Method 9.8: Determination of suspended particulate matter - PM <sub>10</sub> continuous direct mass method using a tapered element oscillating microbalance analyzer.	
PM <sub>2.5</sub> (BAM 1020)	AS/NZS 3580.9.12-2022 <sup>1</sup>	Methods for sampling and analysis of ambient Air - Method 9.12: Determination of suspended particulate matter—PM <sub>2.5</sub> beta attenuation monitors	
Vector Wind Speed (Horizontal)	AS 2923-1987 <sup>2</sup>	Methods for sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications	
Vector Wind Direction	AS 2923-1987 <sup>2</sup>	Methods for sampling and analysis of ambient air. Method 14 Meteorological monitoring for ambient air quality monitoring applications	
Sigma	AS 2923-1987 <sup>2</sup>	Methods of sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications	
Atmospheric Temperature	USEPA (2000) EPA 454/ R-99-005 <sup>2</sup>	Methods for sampling and analysis of ambient air. Method 14: Meteorological monitoring for ambient air quality monitoring applications	

<sup>&</sup>lt;sup>1</sup> As approved by the Department of Planning and Environment on 30<sup>th</sup> August 2021.

<sup>&</sup>lt;sup>2</sup> Superseded by AS/NZ 3580.14 2014 but specifically referenced in ministerial conditions.

#### **Report No: DAT20290**

TfNSW – Rozelle Interchange



Note: Two different measurement techniques are used for monitoring  $PM_{10}$  and  $PM_{2.5}$  at the WCX 3B Project Stations. Studies conducted in Canada, the United States and other countries have found that the Tapered Element Oscillating Microbalance (TEOM) monitors can under report concentrations compared to the Beta Attenuation Monitors (BAM), especially when the air contains a large proportion of semi-volatile particulate matter, which may be the case during cooler seasons when the air contains less coarse dust and a greater proportion of semi-volatile organic compounds such as those associated with wood smoke. As a result, it is normal to see occasional periods where  $PM_{10} < PM_{2.5}$  and this situation does not necessarily indicate a fault with either instrument.

#### 2.3.1. NATA Endorsement and Conformity with Standards

Unless stated below, parameters are monitored at the WCX 3B Project Stations according to the stated methods detailed in Table 3 above.

#### 2.3.2. Data Acquisition

Data acquisition is performed using a PC based Congrego logger situated at each of the monitoring sites. Each logger is equipped with a 4G modem for remote data collection. The recorded data is remotely collected from the Air Quality Monitoring Station (AQMS) loggers on a daily basis (using Airodis<sup>™</sup> version 5.2) and stored at Acoem Australasia (Ecotech)'s Environmental Reporting Services (ERS) department in Melbourne, Australia. Data samples are logged in 5-minute intervals.

#### **Report No: DAT20290**

TfNSW – Rozelle Interchange



#### 2.4. Data Validation and Reporting

#### 2.4.1. Validation

The Acoem Australasia (Ecotech) ERS department performs daily data checks to ensure maximum data capture rates are maintained. Any equipment failures are communicated to the responsible field engineers for urgent rectification. Acoem Australasia (Ecotech) ERS maintains two distinct databases containing non-validated and validated data respectively.

The validated database is created by duplicating the non-validated database and then flagging data affected by instrument faults, calibrations, and other maintenance activities. The data validation software requires the analyst to supply a valid reason (e.g., backed by maintenance notes, calibration sheets etc.) in the database for flagging any data as invalid.

Details of all invalid or missing data are recorded in the Valid Data Exception Tables.

Validation is performed by the analyst, and the validation is reviewed. Graphs and tables are generated based on the validated five-minute (all parameters except PM<sub>2.5</sub>) and one-hour data (PM<sub>2.5</sub> only) as appropriate.

#### 2.4.2. Reporting

Data is reported in four Microsoft Excel format files named:

- WestConnex 3B Site 1 Quirk Street Monthly Data Report August 2023.xlsx
- WestConnex 3B Site 2 Chapman Road Monthly Data Report August 2023.xlsx
- WestConnex 3B Site 3 Manning Street Monthly Data Report August 2023.xlsx
- WestConnex 3B Site 4 Bridgewater Park Monthly Data Report August 2023.xlsx

Each Excel file consists of 6 worksheets:

- 1. Cover
- 2. Contents
- 3. 5-Minute Data
- 4. 1-hour Data
- 5. 24-hour Data
- 6. Valid Data Exception Report

The data contained in this report is based on Australian Eastern Standard Time.

All averages are calculated from the five-minute (all parameters except PM<sub>2.5</sub>) and one-hour data (PM<sub>2.5</sub> only). Averages are based on a minimum of 75% valid readings within the averaging period. Where data capture is low for a particular parameter, summary values (e.g., monthly maximum

#### **Report No: DAT20290**

TfNSW – Rozelle Interchange



and minimum) may be based on less than 75% valid samples. The reader should use caution when interpreting these values as they may not be representative of conditions for the entire sample period.

Averaging periods of eight hours or less are reported for the end of the period, i.e., the hourly average 02:00 am is for the data collected from 1:00 am to 2:00 am. 1-hour averages are calculated based on a clock hour. 24-hour averages are calculated based on calendar days.

# Table 4: Automatic Span / Zero/ Stabilization and Background checks at WestConnex 3Bstations

Station	Parameter	Span / Zero / Stabilization	Background
Quirk Street	NO / NO <sub>2</sub> / NO <sub>x</sub>	01:00 - 01:25	n/a
	СО	01:00 - 01:25	23:55 - 00:00
	NO / NO <sub>2</sub> / NO <sub>x</sub>	01:00 - 01:25	n/a
Chapman Road	СО	01:00 - 01:25	23:50 - 23:55
Manning Street	NO / NO <sub>2</sub> / NO <sub>x</sub>	01:00 - 01:25	n/a
Manning Street	со	01:00 - 01:25	23:45 – 23:50
Bridgewater Park	NO / NO <sub>2</sub> / NO <sub>x</sub>	01:00 - 01:25	n/a
	СО	01:00 - 01:25	23:45 – 23:50

## 3.0 Air Quality Goals

The air quality goals and criteria for pollutants monitored at the WestConnex 3B Project ambient monitoring sites are based on SSI-7485 Planning Approval Condition E6. The air quality goals and criteria are shown in Table 5 below.

TfNSW – Rozelle Interchange



Parameter	Time Period	Goal Level	Units
СО	8 hours (rolling, based on 1-hour averages)	9.0	ppm
NO <sub>2</sub>	1 hour	0.12	ppm
PM <sub>10</sub>	1 day	50	μg/m³
	1 year	25	μg/m³
PM <sub>2.5</sub>	1 day	25	μg/m³
	1 year	8	μg/m³

#### Table 5: WestConnex 3B Project - Air Quality Goals

#### <u>Note:</u>

This report will include all valid data points that exceed the defined air quality standards. The Ambient Air Quality NEPM includes a provision for excluding 1-day PM<sub>10</sub> or PM<sub>2.5</sub> averages associated with "exceptional events" from the total exceedances of the Air Quality standard. The definition of an "exceptional event" is included below for reference. It is the responsibility of the end user of this data to evaluate whether any reported exceedances are associated with exceptional events and are eligible to be excluded from the exceedance total. Monitoring and reporting of exceedances during the operational project will be in accordance with the Planning Approval Conditions E10, E11 and E12.

As per the Ambient Air Quality NEPM, *Exceptional event* means a fire or dust occurrence that adversely affects air quality at a particular location, and causes an exceedance of 1-day average standards in excess of normal historical fluctuations and background levels, and is directly related to: bushfire; jurisdiction authorized hazard reduction burning; or continental scale windblown dust.

#### **Report No: DAT20290**

TfNSW – Rozelle Interchange



## 4.0 Calibrations and Maintenance

#### 4.1. Units and Uncertainties

The uncertainties for each parameter have been determined by the manufacturer's tolerance limits of the equipment's parameters, and by the data collection standard method.

The reported uncertainties are expanded uncertainties, calculated using coverage factors which give a level of confidence of approximately 95%.

Parameter	Units	Resolution	Uncertainty	Measurement Range <sup>3</sup>
NO, NO <sub>x</sub> (S40)	ppm	0.001 ppm	± (6% of reading + 0.011 ppm) k factor of 2.0	0 to 0.5 ppm LDL = 0.0004 ppm
NO <sub>2</sub> (S40)	ppm	0.001 ppm	± (6% of reading + 0.011 ppm) k factor of 2.0	0 to 0.5 ppm LDL = 0.0004 ppm
CO (S30)	ppm	0.1 ppm	± (7% of reading + 0.8 ppm) k factor of 2.0	0 to 50 ppm LDL = 0.04 ppm
PM <sub>2.5</sub> (BAM1020)	μg/m³	1 μg/m³	24Hr: ± (5.5% of reading + 4.0 μg/m³) (in range 0 - 100 μg/m³) Hr: ± (8% of reading + 8.0 μg/m³) k factor of 2.0	0 to 1000 μg/m <sup>3</sup> LDL <sub>24hr</sub> = 1.0 μg/m <sup>3</sup> LDL <sub>hr</sub> = 4.8 μg/m <sup>3</sup>
PM <sub>10</sub> (TEOM)	µg/m³	0.1 μg/m³	± 5.0 μg/m³ or 3.6% of reading, whichever is the greater K factor of 2.0	0 to 1 g/m <sup>3</sup> LDL = 5 μg/m <sup>3</sup>
Vector Wind Speed	m/s	0.1 m/s	± 0.4 m/s or 2 % of reading, whichever is greater K factor of 2.0	0 to 30 m/s
Vector Wind Direction	deg	1 deg	± 4 deg K factor of 2.0	0 to 360 deg <i>Starting threshold:</i> 0 m/s

#### **Table 6: Units and Uncertainties**

<sup>&</sup>lt;sup>3</sup> Uncertainties may not be calculated based on the full measurement range. The max measurement range for gas analyzers is defined as the full scale (FS=Span/0.8).

# Report No: DAT20290



Parameter	Units	Resolution	Uncertainty	Measurement Range <sup>3</sup>
Ambient Temperature	°C	0.1°K	± 0.6°K K factor of 2.0	263.15°K to 323.15°K

TfNSW – Rozelle Interchange



#### 4.2. Maintenance

#### 4.2.1. Calibration & Maintenance Summary Tables

The last calibrations for the following parameters were performed on the indicated dates. Data supplied after this time is subject to further validation, to be performed at the next calibration cycle.

Note: Maintenance and calibration dates may differ, as calibrations may be less frequent than scheduled maintenance visits.

Tables 7-10 indicate when the pollutant and meteorological equipment were last maintained/calibrated.

Parameter	Date of Last Scheduled Maintenance	Maintenance Type⁴	Date of Last Calibration	Calibration Cycle
NO, NO <sub>2</sub> , NO <sub>x</sub>	07/08/23	Monthly	07/08/23	Monthly
СО	07/08/23	Monthly	07/08/23	Monthly
PM <sub>10</sub>	07/08/23	Monthly	26/10/22	Yearly
PM <sub>2.5</sub>	07/08/23	2 Monthly	20/12/22	Yearly
WS/WD/Sigma	07/08/23	Monthly	28/03/22 <sup>5</sup>	2 Yearly
Differential Temperature 2m	07/08/23	Monthly	19/04/23 <sup>6</sup>	6 Monthly
Differential Temperature 10m	13/07/23	Monthly	19/04/23 <sup>7</sup>	6 Monthly

#### Table 7: WCX Quirk Street Maintenance Table - August 2023

<sup>&</sup>lt;sup>4</sup> Additional visits may have been made as required.

<sup>&</sup>lt;sup>5</sup> Wind sensor calibrated on 28/03/2022 and installed at this site on 25/10/22.

<sup>&</sup>lt;sup>6</sup> Function check only. Laboratory calibration performed 4/04/22.

<sup>&</sup>lt;sup>7</sup> Function check only. Laboratory calibration performed 4/04/22.

TfNSW – Rozelle Interchange



Parameter	Date of Last Scheduled Maintenance	Maintenance Type <sup>8</sup>	Date of Last Calibration	Calibration Cycle
NO, NO <sub>2</sub> , NO <sub>x</sub>	07/08/23	3 Monthly	07/08/23	Monthly
СО	07/08/23	Monthly	07/08/23	Monthly
PM <sub>10</sub>	07/08/23	3 Monthly	21/10/22	Yearly
PM <sub>2.5</sub>	07/08/23	2 Monthly	20/10/22	Yearly
WS/WD/Sigma	07/08/23	3 Monthly	25/03/22 <sup>9</sup>	2 Yearly
Differential Temperature 2m	07/08/23	Monthly	17/04/23 <sup>10</sup>	6 Monthly
Differential Temperature 10m	07/08/23	Monthly	17/04/2311	6 Monthly

#### Table 8: WCX Chapman Road Maintenance Table August 2023

<sup>&</sup>lt;sup>8</sup> Additional visits may have been made as required.

 $<sup>^9</sup>$  Wind sensor calibrated on 25/03/22 and installed at this site on 20/10/22.

<sup>&</sup>lt;sup>10</sup> Function check only. Laboratory calibration performed 4/04/22.

<sup>&</sup>lt;sup>11</sup>Function check only. Laboratory calibration performed 7/04/22.

TfNSW – Rozelle Interchange



Parameter	Date of Last Scheduled Maintenance	Maintenance Type <sup>12</sup>	Date of Last Calibration	Calibration Cycle
NO, NO <sub>2</sub> , NO <sub>x</sub>	28/08/23	Monthly	28/08/23	Monthly
СО	28/08/23	Monthly	28/08/23	Monthly
PM <sub>10</sub>	28/08/23	Monthly	18/10/22	Yearly
PM <sub>2.5</sub>	25/08/23	2 Monthly	18/10/22	Yearly
WS/WD/Sigma	28/08/23	Monthly	08/04/22 <sup>13</sup>	2 Yearly
Differential Temperature 2m	28/08/23	Monthly	11/05/23 <sup>14</sup>	6 Monthly
Differential Temperature 10m	28/08/23	Monthly	11/05/23 <sup>15</sup>	6 Monthly

#### Table 9: WCX Manning Street Maintenance Table August 2023

<sup>&</sup>lt;sup>12</sup> Additional visits may have been made as required.

 $<sup>^{\</sup>rm 13}$  Wind sensor calibrated on 08/04/22 and installed at this site on 19/10/22.

<sup>&</sup>lt;sup>14</sup> Function check only. Laboratory calibration performed 31/03/22.

<sup>&</sup>lt;sup>15</sup> Function check only. Laboratory calibration performed 7/04/22.

TfNSW – Rozelle Interchange



Parameter	Date of Last Scheduled Maintenance	Maintenance Type <sup>16</sup>	Date of Last Calibration	Calibration Cycle
NO, NO <sub>2</sub> , NO <sub>x</sub>	28/08/23	3 Monthly	28/08/23	Monthly
СО	28/08/23	Monthly	28/08/23	Monthly
PM <sub>10</sub>	28/08/23	3 Monthly	01/11/22	Yearly
PM <sub>2.5</sub>	28/08/23	2 Monthly	01/11/22	Yearly
WS/WD/Sigma	28/08/23	3 Monthly	26/03/22 <sup>17</sup>	2 Yearly
Differential Temperature 2m	28/08/23	3 Monthly	12/05/23 <sup>18</sup>	6 Monthly
Differential Temperature 10m	28/08/23	3 Monthly	12/05/23 <sup>19</sup>	6 Monthly

#### Table 10: WCX Bridgewater Park Maintenance Table August 2023

<sup>&</sup>lt;sup>16</sup> Additional visits may have been made as required.

<sup>&</sup>lt;sup>17</sup> Wind sensor calibrated on 26/03/22. Installed at this site and function check performed on 01/11/22.

<sup>&</sup>lt;sup>18</sup> Function check only. Laboratory calibration performed 31/03/22.

<sup>&</sup>lt;sup>19</sup> Function check only. Laboratory calibration performed 4/04/22.

#### **Report No: DAT20290**

TfNSW – Rozelle Interchange



## 5.0 Results

#### 5.1. Data Capture

Valid data capture refers to the amount of valid data collected during the report period. It is based on 5-minute data, for gaseous and meteorological parameters and 1-hour data for particulate parameters.

The percentage of valid data captured is calculated using the following equation:

Valid Data capture = (Reported air quality data / Total data) x 100%

Where:

- Reported air quality data = Number of samples (instrument readings) which have been validated through a quality assured process and excludes all data errors, zero data collection due to calibration, equipment failures, planned and unplanned maintenance.
- Total data = Total number of samples (instrument readings) expected for the sampling period. Total data is calculated based on the same averaging period as "reported air quality data" and the duration of the corresponding report period. e.g., for 5-minute data collected over a month of 31 days, the total data would be equal to 12 (5-minute samples in an hour) x 24 (hours in a day) x 31 (days in a month) = 8928 samples.

Table 11 below displays data capture statistics for August 2023. **Bold** values in the table indicate data capture below 95%.

Details of all invalid or missing data affecting data capture are included in the Valid Data Exception Tables, see section 6.0.

TfNSW – Rozelle Interchange



	Data Capture (%)				
Parameter	Quirk Street	Chapman Road	Manning Street	Bridgewater Park	
PM <sub>2.5</sub>	99.7	99.5	97.2	99.2	
PM <sub>10</sub>	99.9	99.3	99.6	97.9	
СО	97.2	96.8	96.9	96.8	
NO, NO <sub>2</sub> , NO <sub>x</sub>	97.8	97.6	97.5	97.4	
WS, WD, Sigma	99.9	99.7	99.6	97.3	
AT 2m	99.9	99.7	99.6	99.6	
AT 10m	99.9	99.6	99.6	99.6	

#### Table 11: Data Capture for WCX 3B Project Ambient Air Quality Network

TfNSW – Rozelle Interchange



#### 5.2. Air Quality Monthly Summary

Tables 12-15 below include a summary of any exceedances recorded at the WCX 3B Project stations during the reported period<sup>20</sup>.

Parameter	Time Period	Value of Exceedance	Date of Exceedance
NO <sub>2</sub> (ppm)	1 hour	-	-
CO (ppm)	8-hour rolling	-	-
$DM (ug/m^3)$	24-hour	-	-
PM <sub>10</sub> (μg/m³)	Annual <sup>21</sup>	-	-
$DM = (\mu \sigma/m^3)$	24-hour	-	-
PM <sub>2.5</sub> (μg/m³)	Annual <sup>22</sup>	-	-

#### Table 12: WCX Quirk Street Exceedances Recorded for August 2023

<sup>&</sup>lt;sup>20</sup> Exceedances are based on the decimal places reported.

<sup>&</sup>lt;sup>21</sup> Insufficient data to report annual average. The first annual average concentrations will be calculated on the first day the project has been in operation for 12 months and on a rolling basis thereafter.

<sup>&</sup>lt;sup>22</sup> As in 21 above.

TfNSW – Rozelle Interchange



#### Table 13: WCX Chapman Road Exceedances Recorded for August 2023

Parameter	Time Period	Value of Exceedance	Date of Exceedance
NO <sub>2</sub> (ppm)	1 hour	-	-
CO (ppm)	8-hour rolling	-	-
PM <sub>10</sub> (μg/m³)	24-hour	-	-
	Annual <sup>23</sup>	-	-
	24-hour	-	-
PM <sub>2.5</sub> (μg/m³)	Annual <sup>24</sup>	-	-

<sup>&</sup>lt;sup>23</sup> Insufficient data to report annual average. The first annual average concentrations will be calculated on the first day the project has been in operation for 12 months and on a rolling basis thereafter.

<sup>&</sup>lt;sup>24</sup> As per 23 above.

TfNSW – Rozelle Interchange



#### Table 14: WCX Manning Street Exceedances Recorded for August 2023

Parameter	Time Period	Value of Exceedance	Date of Exceedance
NO <sub>2</sub> (ppm)	1 hour	-	-
CO (ppm)	8-hour rolling	-	-
$DM (ug/m^3)$	24-hour	-	-
PM <sub>10</sub> (μg/m³)	Annual <sup>25</sup>	-	-
$DM = (\mu \sigma/m^3)$	24-hour	-	-
PM <sub>2.5</sub> (μg/m³)	Annual <sup>26</sup>	-	-

<sup>&</sup>lt;sup>25</sup> Insufficient data to report annual average. The first annual average concentrations will be calculated on the first day the project has been in operation for 12 months and on a rolling basis thereafter.

<sup>&</sup>lt;sup>26</sup> As per 25 above.

TfNSW – Rozelle Interchange



#### Table 15: WCX Bridgewater Park Exceedances Recorded for August 2023

Parameter	Time Period	Value of Exceedance	Date of Exceedance
NO <sub>2</sub> (ppm)	1 hour	-	-
CO (ppm)	8-hour rolling	-	-
$DM (ug/m^3)$	24-hour	-	-
PM <sub>10</sub> (μg/m³)	Annual <sup>27</sup>	-	-
$DM = (\mu \sigma/m^3)$	24-hour	-	-
PM <sub>2.5</sub> (μg/m³)	Annual <sup>28</sup>	-	-

<sup>&</sup>lt;sup>27</sup> Insufficient data to report annual average. The first annual average concentrations will be calculated on the first day the project has been in operation for 12 months and on a rolling basis thereafter.

<sup>&</sup>lt;sup>28</sup> As per 27 above.

TfNSW – Rozelle Interchange



#### 5.3. Tabulated data

#### 5.3.1. Annual average

Table 16 displays monthly averages of the PM<sub>2.5</sub> and PM<sub>10</sub> parameters collected at WCX 3B ambient air monitoring stations for 2023. Averages shown are for the 2023 calendar year, up to the current reported month. Table requires at least 75% valid data to display a monthly average. Footer values are based on all available data for 2023 rather than the average of individual months. This gives an indication of performance against the annual objectives.

#### Table 16: $PM_{10}$ and $PM_{2.5}$ averages at the WCX 3B ambient air monitoring stations 2023


	Quirk	Street	Chapma	an Road	Mannin	g Street	Bridgew	ater Park
Month	PM10 (μg/m³)	ΡM <sub>2.5</sub> (μg/m³)	PM10 (μg/m³)	ΡΜ2.5 (μg/m³)	PM10 (μg/m³)	ΡM <sub>2.5</sub> (μg/m³)	PM10 (μg/m³)	ΡM2.5 (μg/m³)
Jan-23	14.6	4	16.4	4	15.1	3	15.2	3
Feb-23	17.9	4	20.2	5	17.0	4	18.6	3
Mar-23	17.4	4	21.6	6	17.4	4	18.3	3
Apr-23	12.7	3	16.4	5	13.1	3	13.7	3
May-23	14.1	5	19.8	7	13.9	4	14.1	5
Jun-23	13.1	6	20.4	9	12.8	5	12.8	5
Jul-23	14.2	7	24.3	12	13.5	6	14.9	5
Aug-23	14.5	6	20.3	9	13.8	6	14.7	5
Sep-23	-	-	-	-	-	-	-	-
Oct-23	-	-	-	-	-	-	-	-
Nov-23	-	-	-	-	-	-	-	-
Dec-23	-	-	-	-	-	-	-	-
Average	14.9	5	19.9	7	14.7	4	15.4	4

TfNSW – Rozelle Interchange



#### 5.4. Graphic Representations

This section displays graphs of the pollutants and meteorological parameters monitored at the WCX 3B Project for June 2023. The graphs are based on validated 5-minute or 1-hour data as appropriate.

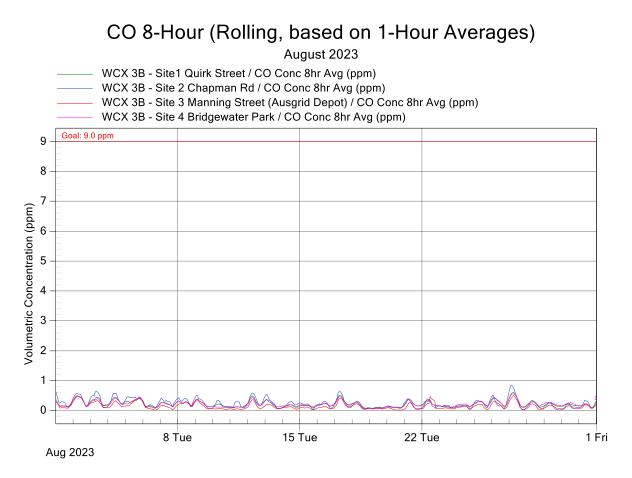

#### Figure 2: WCX 3B Project Air Monitoring Stations - CO 8-Hour Rolling Graph for August 2023

#### **Report No: DAT20290**



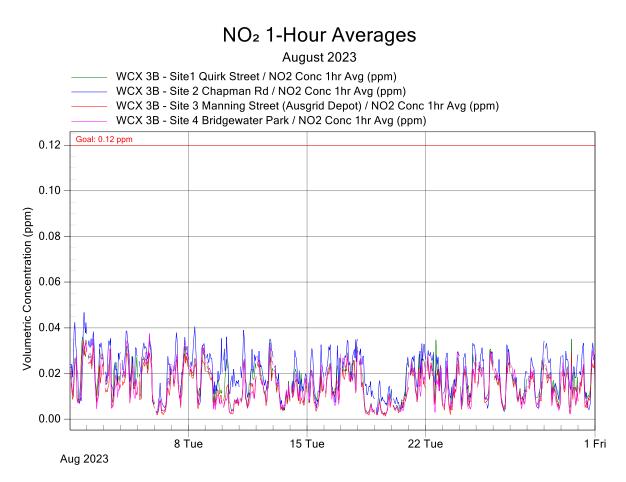


Figure 3: WCX 3B Project Air Monitoring Stations - NO<sub>2</sub> 1-Hour Averages Graph for August 2023

#### Report No: DAT20290



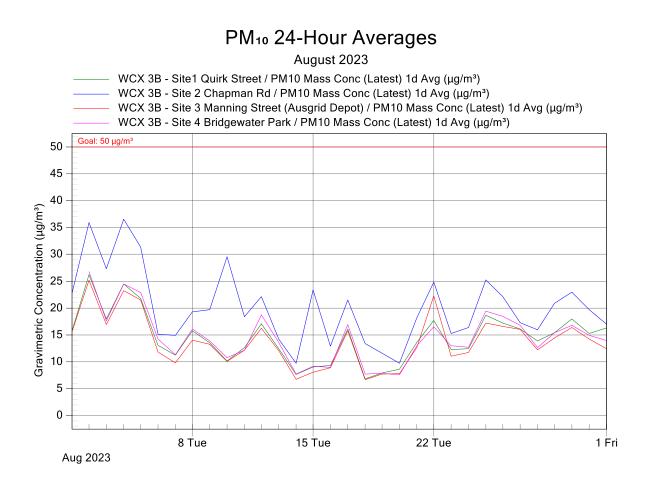


Figure 4: WCX 3B Project Air Monitoring Stations - PM<sub>10</sub> 24-Hour Averages Graph for August 2023

#### **Report No: DAT20290**




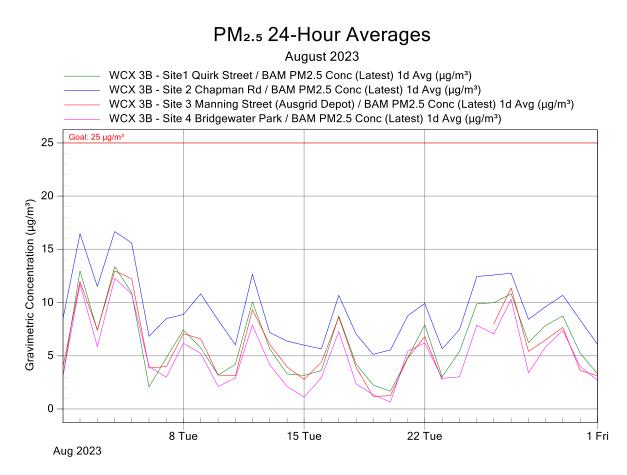


Figure 5: WCX 3B Project Air Monitoring Stations - PM<sub>2.5</sub> 24-Hour Averages Graph for August 2023

TfNSW – Rozelle Interchange



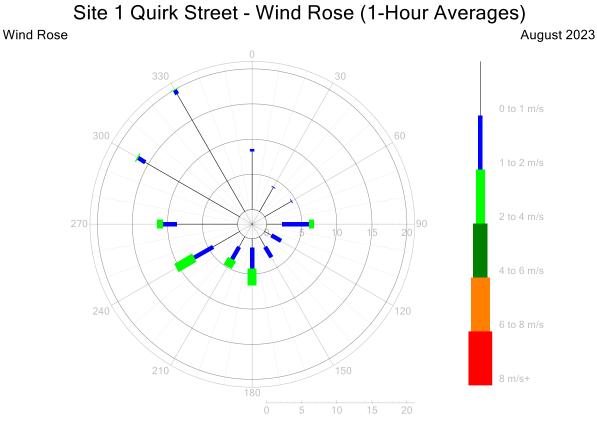


99.9% valid data present


Figure 6: WCX Quirk Street - Wind Rose of August 2023

TfNSW – Rozelle Interchange



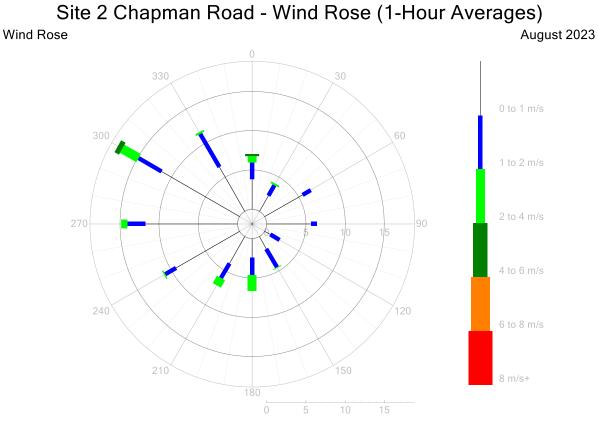


99.7% valid data present




TfNSW – Rozelle Interchange



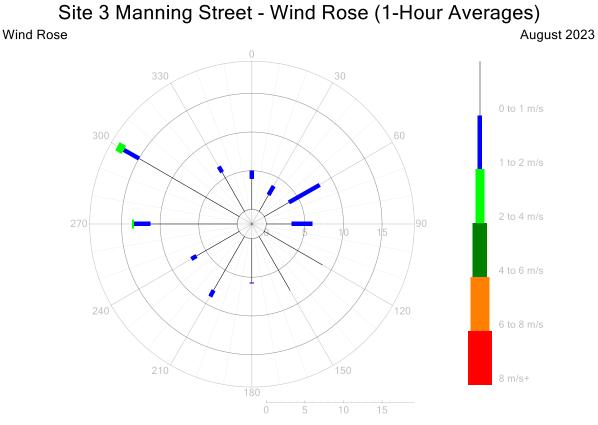


99.5% valid data present



#### Page **34** of **43**

TfNSW – Rozelle Interchange



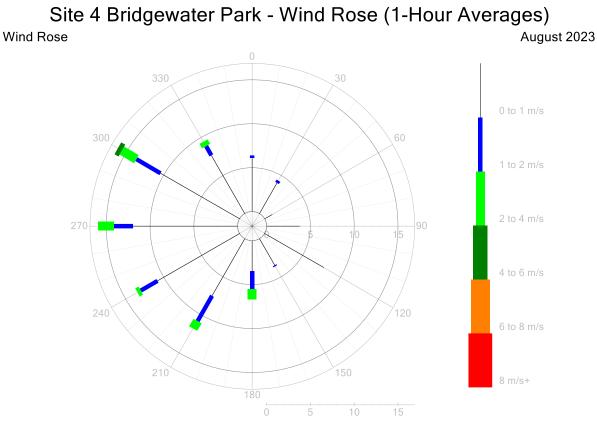

97.0% valid data present

Figure 9:WCX Bridgewater Park - Wind Rose of August 2023

TfNSW – Rozelle Interchange



## 6.0 Valid Data Exception Tables

Tables 17–20 below detail all changes made to the raw data set during the validation process. An explanation of reasons given in the table can be found in Appendix 2.

Start Date	End Date	Reason	Change Details	User Name	Change Date
07/08/23 10:00	07/08/23 11:00	Scheduled 2 monthly maintenance - Instrument calibration & checks followed by instrument stabilization	All parameters	EQ	28/09/23

#### Table 17: WCX Quirk Street Valid Data Exception Table

Start Date	End Date	Reason	Change Details	User Name	Change Date
03/08/23 12:05	25/08/23 10:05	Intermittent instrument fault - unrealistic data	AT 10m	EQ	28/09/23
07/08/23 11:00	07/08/23 13:05	Scheduled 2 monthly maintenance	All parameters	EQ	28/09/23
20/08/23 01:30	21/08/23 00:55	Linear offset of A= +0.1 ppm and B= +0.15 ppm applied to correct the drift in CO baseline	СО	EQ	28/09/23
21/08/23 01:30	31/08/23 23:45	Static offset of +0.1 to +0.25 ppm applied to correct baseline	СО	EQ	28/09/23
22/08/23 01:30	23/08/23 00:55	Linear offset of A= +0.1 ppm and B= +0.3 ppm applied to correct the drift in CO baseline	СО	EQ	28/09/23
25/08/23 13:50	28/08/23 13:55	Intermittent power outage followed by instrument stabilization	All parameters	EQ	28/09/23
26/08/23 11:20	26/08/23 11:25	Instrument fault - CO status error	СО	EQ	28/09/23

## Table 18: WCX Chapman Road Valid Data Exception Table

# Report No: DAT20290

TfNSW – Rozelle Interchange



#### Table 19: WCX Manning Street Valid Data Exception Table

Start Date	End Date	Reason	Change Details	User Name	Change Date
02/08/23 01:30	31/08/23 23:45	Static offsets between +0.05 ppm to +0.10 ppm applied as required to correct unstable baseline	со	EQ	28/09/23
05/08/23 01:30	06/08/23 00:55	Linear offset of A= +0.0 ppm and B= +0.15 ppm applied to correct the drift in CO baseline	СО	EQ	28/09/23
10/08/23 12:50	30/08/23 13:20	Intermittent unrealistic negative readings	NO, NO <sub>2</sub> , NO <sub>x</sub>	EQ	28/09/23
13/08/23 01:30	14/08/23 00:55	Linear offset of A= +0.0 ppm and B= +0.1 ppm applied to correct the drift in CO baseline	СО	EQ	28/09/23
24/08/23 16:00	25/08/23 09:00	Instrument fault - tape break	PM <sub>2.5</sub>	EQ	28/09/23
25/08/23 09:35	25/08/23 10:35	Scheduled 2 monthly maintenance - BAM1020 maintenance performed	All parameters	EQ	28/09/23
28/08/23 12:00	28/08/23 13:35	Scheduled 2 monthly maintenance	All parameters	EQ	28/09/23

# Report No: DAT20290

TfNSW – Rozelle Interchange



#### Table 20: WCX Bridgewater Park Valid Data Exception Table

Start Date	End Date	Reason	Change Details	User Name	Change Date
01/08/23 00:25	01/08/23 09:15	Intermittent instrument fault - TEOM frozen	PM10	EQ	28/09/23
01/08/23 09:20	01/08/23 10:55	Non scheduled maintenance - instrument remotely restarted followed instrument stabilization	PM <sub>10</sub>	EQ	28/09/23
28/08/23 14:00	28/08/23 15:55	Scheduled 3 monthly maintenance	All parameters	EQ	28/09/23
30/08/23 17:25	31/08/23 10:20	Instrument fault - unrealistic data	WS, WD, Sigma	EQ	28/09/23
31/08/23 17:45	31/08/23 18:55	Power outage followed by instrument stabilization	All parameters	EQ	28/09/23

#### **Report No: DAT20290**

TfNSW – Rozelle Interchange



#### 7.0 Report Summary

• Percentage availability for all parameters at the WestConnex 3B Ambient Air Quality Monitoring Network was above 95% during the reporting month.

Please refer to Table 11, and Tables 17-20 for details.

• There were no exceedance of the air quality goals at the WestConnex 3B Ambient Air Quality Monitoring station for the reporting month.

Please refer to Tables 12-15 in Section 5.2 – Air Quality Monthly Summary for further information.

TfNSW – Rozelle Interchange



# **Appendix 1** - **Definitions & Abbreviations**

ERS	Environmental Reporting Services		
AQMS	Air Quality Monitoring Station		
AQM	Air Quality Monitor		
BAM	Beta Attenuation Monitors		
TEOM	Tapered Element Oscillating Microbalance		
o	Degrees (True North)		
К	Kelvin		
LDL	Lower Detectable Limit		
µg/m³	Micrograms per cubic meter at standard temperature and pressure (0°C and 101.3 kPa)		
AT	Ambient Temperature		
calm	Wind conditions where the wind speed is below the operating range of the wind sensor		
СО	Carbon monoxide		
mg/m³	Milligrams per cubic meter at standard temperature and pressure (0°C and 101.3 kPa)		
mm	Millimeter		
NO	Nitric oxide		
NO <sub>2</sub>	Nitrogen dioxide		
NO <sub>x</sub>	Oxides of nitrogen		
PM <sub>10</sub>	Particulate less than 10 microns in equivalent aerodynamic diameter		
PM <sub>2.5</sub>	Particulate less than 2.5 microns in equivalent aerodynamic diameter		

# Report No: DAT20290



ppb	Parts per billion
ppm	Parts per million

- RH Relative Humidity
- WD Vector Wind Direction
- WS Vector Wind Speed

TfNSW – Rozelle Interchange



## **Appendix 2 - Explanation of Exception Table**

Automatic filter tape advance refers to the movement of the filter paper by the analyzer to an unused spot.

Automatic background check refers to when analyzer samples zero air and measures the level of the concentration voltage. This voltage is taken as the zero-signal level and this value is subtracted from any subsequent readings as an active zero compensation. This is the analyzer's fine zero measurement.

**Automatic span/zero check.** The E-Sampler is programmed to perform a zero calibration check whereby air is passed through filter element, removing particulates, before entering the sensor in the analyzer. Data is invalidated when these checks occur.

**Beta count failure** refers to a fault in the functioning of the EBAM. A one-minute beta count was less than the maximum acceptable counts during operation.

**Calibration check outside tolerance** refers to when the calibration values are outside the tolerance limits set for the precision check.

**Calibration correction factor applied to data** refers to an offset or multiplier applied to the data. This operation may be performed for a number of reasons including: (a) when a clear trend / drift outside the tolerance limit can be demonstrated by repeated operation precision checks, (b) when a correction is required on previously logged data due to a calibration check being outside the allowable tolerance

**Commissioning** refers to the initial setup and calibration of the instrument when it is first installed. For some instruments there may be a stabilization period before normal operation commences.

**Data transmission error** refers to a period of time when the instrument could not transmit data. This may be due to interference, or a problem with the phone line or modem.

**Equipment malfunction/instrument fault** refers to a period of time when the instrument was not in the normal operating mode and did not measure a representative value of the existing conditions.

**Gap in data/data not available** refers to a period of time when either data has been lost or could not be collected.

**Instrument Alarm** refers to an alarm produced by the instrument. A range of alarms can be produced depending on how operation of the instrument is being affected.

## Report No: DAT20290

TfNSW – Rozelle Interchange



**Instrument out of service** refers to a lack of data due to an instrument being shut down for repair, maintenance, or factory calibration.

**Linear offset or multiplier** refers to when an offset or multiplier has been applied between two points where the values of the offset or multiplier are different and the correction is interpolated between the two points.

**Logger error** refers to when an error occurs and instrument readings are not correctly recorded by the logger.

**Maintenance** refers to a period of time when the logger/instrument was switched off due to maintenance.

**Overnight span/zero out of tolerance** refers to when the span/zero reading measured by the analyzer during an automatic precision check falls outside of the expected concentration limits.

**Overnight zero out of tolerance** refers to when the automatic zero reading measured by the analyzer falls outside the expected limits.

**Power Interruption** refers to no power to the station therefore no data was collected at this time.

**Remote Calibration** refers to when a technician remotely connects to the station and manually performs a span check.

**Static offset or multiplier** refers to when a single offset or multiplier has been applied to the data between two points either to increase or decrease the measured value.

**Tape break** refers to the breaking of the EBAM/BAM sample tape during operation.

**Warm up after power interruption** refers to the startup period of an instrument after power has been restored.